

THE **adlog**TM AIRCRAFT
MAINTENANCE
RECORDKEEPING
SYSTEM

**ENGINE
MAINTENANCE
RECORDS**

DRAIN OIL AND REMOVE FILTER , CUT FILTER AND INSPECT , NO DEBRIS , ADD 10 QTS PHILLIPS 20W/50 OIL AND 1 PINT CAMGUARD , INSTALL CHAMPION FILTER CH48109-1 AND SAFTEY , PERFORM BOREScope ON CYLINDERS NO DEFECTS NOTED , PERFORM COMPRESSION TEST ON CYLINDERS AS FOLLOWS #1 70/80 , #2 60/80 , #3 66/80 , #4 66/80 , #5 64/80 , #6 66/80 , CHECK ALL FLUID LINES , CLEAN SPARK PLUGS AND GAP , NEW M674 GASKETS , INSPECT INTAKE AND EXHAUST SYSTEM , REPLACE A/C BELT # 9341HD GREEN STRIPE AND REPLACE BELT GUARD BRACKET 3 36-555048-3 , REPLACE BRACKETT AIR FILTER ELEMENT , TEST RUN NO LEAKS.

ROY S. PLACKIS CERT.# 3122678 I/A.

Roy S. Perkins

PERFORM FUEL INJECTION CLEANING , TEST RUN FOR LEAKS SATISFACTORY

TEST FLIGHT SATISFACTORY , ENGINE PARAMETERS NORMAL.

ROY S. PLACKIS A/P 3122678

By S. Plock


SUB-TOTALS this page

TOTALS-Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page


	Baker Aviation	
	333 South Street, New Smyrna, FL	
	386-837-4073	
	Date:	01/22/24
	Registration:	N934PC
	Make/ Model:	A36
Serial Number:	E-3448	
Tach / Hobbs:	2624.6	

- Removed all 6 cylinders and replaced with new Superior Millennium cylinders, p/n 6A52006-A1 with s/n's as follows:
 - 1. 526000022799
 - 2. 526000022793
 - 3. 526000022798
 - 4. 526000022803
 - 5. 526000022802
 - 6. 526000022800
- Installed cylinders using all new gaskets.
- Replaced all piston pins with new, p/n 630046
- Replaced all spark plugs with new, p/n URHB32E
- Replaced crankshaft seal with new, p/n 641250
- Replaced all intake lifter with new, p/n 658088.
- Replaced all exhaust lifters with new, p/n 658077
- Replaced 1 CHT probe with new.
- Serviced engine with 10 quarts Aeroshell 100M and new Tempest AA48109-1 filter.
- Work performed with reference to the Textron Beechcraft Model 36 Maintenance manual and the Continental Aerospace M-0 Maintenance and Overhaul manual.
- I approve this work for return to service.


Curtis Boulware A&P 32328171A

	Baker Aviation	
	333 South Street, New Smyrna, FL	
	386-837-4073	
	Date:	03/07/24
	Registration:	N934PC
	Make/ Model:	A36
Serial Number:	E-3448	
Tach / Hobbs:	2640.6	

- Drained engine oil and serviced engine with 10 quarts Phillips 20W50, a new Tempest AA48109-1 filter, and 1 pint ASL Camguard. Cut old filter to check for contaminants, none noted.
- Work performed with reference to the Textron Beechcraft Model 36 Maintenance manual and the Continental Aerospace M-0 Maintenance and Overhaul manual.
- I approve this work for return to service.


Curtis Boulware A&P 32328171A

SUB-TOTALS this page

TOTALS-Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page


 ABS CENTER OF EXCELLENCE	Baker Aviation	
	333 South Street, New Smyrna, FL 386-837-4073	
	Date:	01/22/24
	Registration:	N934PC
	Make/ Model:	A36
	Serial Number:	E-3448
Tach / Hobbs:	2624.6	

- Removed all 6 cylinders and replaced with new Superior Millennium cylinders, p/n 6A52006-A1 with s/n's as follows:
 - 1. 526000022799
 - 2. 526000022793
 - 3. 526000022798
 - 4. 526000022803
 - 5. 526000022802
 - 6. 526000022800
- Installed cylinders using all new gaskets.
- Replaced all piston pins with new, p/n 630046
- Replaced all spark plugs with new, p/n URHB32E
- Replaced crankshaft seal with new, p/n 641250
- Replaced all intake lifter with new, p/n 658088.
- Replaced all exhaust lifters with new, p/n 658077
- Replaced 1 CHT probe with new.
- Serviced engine with 10 quarts Aeroshell 100M and new Tempest AA48109-1 filter.
- Work performed with reference to the Textron Beechcraft Model 36 Maintenance manual and the Continental Aerospace M-0 Maintenance and Overhaul manual.
- I approve this work for return to service.


 Curtis Boulware A&P 32328171A

 ABS CENTER OF EXCELLENCE	Baker Aviation	
	333 South Street, New Smyrna, FL 386-837-4073	
	Date:	03/07/24
	Registration:	N934PC
	Make/ Model:	A36
	Serial Number:	E-3448
Tach / Hobbs:	2640.6	

- Drained engine oil and serviced engine with 10 quarts Phillips 20W50, a new Tempest AA48109-1 filter, and 1 pint ASL Camguard. Cut old filter to check for contaminants, none noted.
- Work performed with reference to the Textron Beechcraft Model 36 Maintenance manual and the Continental Aerospace M-0 Maintenance and Overhaul manual.
- I approve this work for return to service.


 Curtis Boulware A&P 32328171A

SUB-TOTALS this page

TOTALS-Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page

N934PC TACH 2557.8 ENGINE T.T SMOH 779.8 11-07-2022

DRAIN OIL AND REMOVE FILTER, CUT FILTER NO DEBRIS, ADD 9 QTS PHILLIPS 20/50 OIL, INSTALL CHAMPION CH48109-1 FILTER AND SAFETY, ADD 1 PINT CAMGUARD, TEST RUN FOR LEAKS OK.

ROY S. PLACKIS A/P 3122678

Roy S. Plackis

N934PC ENGINE S/N 685951 HOBBS 2590.6 TSMOH 812.6

DRAIN OIL AND REMOVE FILTER, CUT FILTER NO DEBRIS, ADD 10 QTS PHILLIPS 20/50 OIL AND CHAMPION 48109-1 FILTER AND SAFETY, PERFORM BOREScope ON CYLINDERS, CLEAN GAP AND TEST SPARK PLUGS, NEW M674 PLUG GASKETS, COMPRESSION TEST AS FOLLOWS #1 70/80, #2 60/80 #3 66/80, #4 60/80, #5 62/80, #6 60/80, TEST RUN NO LEAKS.

I CERTIFY THAT THIS ENGINE HAS MBEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND FOUND TO BE IN AIRWORTHY CONDITION. ALL AD'S CHECKED THRU THIS DATE 6-1-2023.

ROY S. PLACKIS CERT#3122678I/A

Roy S. Plackis

N934PC TACH 2619.8 TSMOH 841.7 10/31/23

DRAIN OIL AND REMOVED FILTER, CUT FILTER NO DEBRIS -
ADD 9 QTS Shell 100W OIL - INSTALL Champion
CH48109-1 FILTER AND SAFETY. TEST RUN FOR LEAKS - OK.*James C. Bennett* ADP 308648164

Lawrence A. Bennett

SUB-TOTALS this page

TOTALS-Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page

06-21-2021 N934PC Tach 2490.7 Annual inspection 712.7 TSMOH

Drain engine oil and remove filter, Cut filter no debris found, add 9 quarts 20W/50 phillips oil and install champion oil filter ch48109-1 and safety, clean fuel injectors, clean spark plugs/gap/test/new gaskets, compression test on cylinders as follows 1-68/80 2-65/80 3-65/80 4-66/80 5-68/80 6-66/80 mag timing checked, inspect oil and fuel lines, inspect intake and exhaust system, test run for leaks satisfactory

I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND FOUND TO BE IN AIRWORTHY CONDITION. A/D NOTES CHECKED TO THIS DATE 06-21-2021 AND BI-WEEKLY #2021-12 USING BEECHCRAFT INSPECTION GUIDE

Roy S. Plackis Cert.#3122678 I/A

Roy S. Plackis

12/2/2021	Tach 2512.6	DEAINED Oil	and Removed filter	Services with 11 quarts
		Phillips 66 20W50 oil	and Champion CH 48109-1 oil filter.	
		<i>Paul A. Dorell</i>	<i>Lawrence A. Dorell</i>	A/D 308648164



1/19/2022 N934PC Bonanza A-36

Removed and replaced right side muffler assembly, P/N 701-19. Re-installed existing heat baffling and scat hose. Re-positioned left tail pipe to stop rubbing on cowing. All Systems tested and functional. I certify these repairs have been made IAW Bonanza, continental mm and AC43.13 and are deemed airworthy at this time.

Jan Eric Knelson
Jan Eric Knelson AP37917181A

N934PC HOBBS 2528.6 CONT. IO-550-B S/N 685951 TSMOH 750.6

DRAIN OIL AND REMOVE FILTER, CUT FILTER NO DEBRIS, ADD 10 QTS 20/50 PHILLIPS AND CHAMPION CH48109-1 FILTER AND SAFETY, PERFORM COMPRESSION TEST AND BORESCOPE, CHECK MAG TIMING CYLINDER COMPRESSIONS 1 60/80, 2 60/80, 3 72/80, 4 64/80, 5 70/80, 6 62/80, REPLACE 1 RHB32E SPARK PLUG, LUBE ALL ENGINE CONTROLS, CLEAN, GAP AND TEST PLUGS, TEST RUN FOR LEAKS.

I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND FOUND TO BE IN AIRWORTHY CONDITION. AD'S CHECKED THROUGH THIS DATE 6-6-2022

ROY S. PLACKIS CERT# 3122678 I/A

Roy S. Plackis

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page

06-21-2021 N934PC Tach 2490.7 Annual inspection 712.7 TSMOH

Drain engine oil and remove filter, Cut filter no debris found, add 9 quarts 20W/50 phillips oil and install champion oil filter ch48109-1 and safety, clean fuel injectors, clean spark plugs/gap/test/new gaskets, compression test on cylinders as follows 1-68/80 2-65/80 3-65/80 4-66/80 5-68/80 6-66/80 mag timing checked, inspect oil and fuel lines, inspect intake and exhaust system, test run for leaks satisfactory

I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND FOUND TO BE IN AIRWORTHY CONDITION. A/D NOTES CHECKED TO THIS DATE 06-21-2021 AND BI-WEEKLY #2021-12 USING BEECHCRAFT INSPECTION GUIDE

Roy S. Plackis Cert.#3122678 I/A

Roy S. Plackis

12/2/2021	Tach 2512.6	DEAILED OIL	and removed filter	Services with 11 quarts
		Phillips 66 20W50 oil	and Champion CH 48109-1 oil filter.	
		<i>Lawrence A. Dinnell</i>	<i>Lawrence A. Dinnell</i>	AID 308648164



1/19/2022 N934PC Bonanza A-36

Removed and replaced right side muffler assembly, P/N 701-19. Re-installed existing heat baffling and scat hose. Re-positioned left tail pipe to stop rubbing on cowing. All Systems tested and functional. I certify these repairs have been made IAW Bonanza, continental mm and AC43.13 and are deemed airworthy at this time.

Jan Eric Knelson

Jan Eric Knelson AP3791718IA

N934PC HOBBS 2528.6 CONT. IO-550-B S/N 685951 TSMOH 750.6


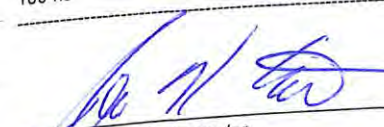
DRAIN OIL AND REMOVE FILTER, CUT FILTER NO DEBRIS, ADD 10 QTS 20/50 PHILLIPS AND CHAMPION CH48109-1 FILTER AND SAFETY, PERFORM COMPRESSION TEST AND BORESCOPE, CHECK MAG TIMING CYLINDER COMPRESSIONS 1 60/80, 2 60/80, 3 72/80, 4 64/80, 5 70/80, 6 62/80, REPLACE 1 RHB32E SPARK PLUG, LUBE ALL ENGINE CONTROLS, CLEAN, GAP AND TEST PLUGS, TEST RUN FOR LEAKS.




I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND FOUND TO BE IN AIRWORTHY CONDITION. AD'S CHECKED THROUGH THIS DATE 6-6-2022

ROY S. PLACKIS CERT# 3122678 I/A

Roy S. Plackis

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page
				 Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 Cincinnati, Ohio 45226 513-871-9966 Date: June 18, 2015 Hobbs:1922.4 AFTT:1922.4 Eng TT:1922.4 TSO:144.3 Prop TT:1922.4 W.O.# E6503 N934PC Beech A36 S/N E-3448 Completed inspection this date in accordance with FAR 43 Appendix D. Serviced and lubricated aircraft in accordance with Beech Service Manual. Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Compressions: #1 72/80 #2 74/80 #3 75/80 #4 76/80 #5 77/80 #6 75/80. Tighten right tailpipe clamp. Replaced air conditioning compressor belt guard, 36-555048-3. AD2014-05-29 Superior Cylinders, DNA not installed. Washed down, run-up and leak checked. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with a 100 hour inspection and has been found to be in an airworthy condition. _____end_____  Joseph K. Schott, Inspector
				 Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 Cincinnati, Ohio 45226 513-871-9966 fax 513-871-9261 Sept. 16, 2015 Hobbs: 1960.8 WO# E6619 Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Washed down, run-up and leak checked. _____end_____  Joseph K. Schott, Inspector
				 Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 Cincinnati, Ohio 45226 513-871-9966 Date: April 21, 2016 Hobbs:1992.8 AFTT:1992.8 Eng. TT:1992.8 Eng. TSO:214.7 Prop TT:1992.8 W.O.# E6829 N934PC Beech A-36 S/N E-3448 Completed inspection this date in accordance with FAR 43 Appendix D. Serviced and lubricated aircraft in accordance with Beech Service Manual. Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Compressions: #1 79/80 #2 75/80 #3 78/80 #4 77/80 #5 78/80 #6 78/80. Removed, cleaned and reinstalled fuel nozzles. Adjust air conditioner compressor belt tension. Washed down, run-up and leak checked. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with a 100 hour inspection and has been determined to be in an airworthy condition. _____end_____  Joseph K. Schott, Inspector

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page
				 Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 Cincinnati, Ohio 45226 513-871-9966 W.O.# E6503 N934PC Beech A36 S/N E-3448 Date: June 18, 2015 Hobbs:1922.4 AFTT:1922.4 Eng TT:1922.4 TSO:144.3 Prop TT:1922.4 Completed inspection this date in accordance with FAR 43 Appendix D. Serviced and lubricated aircraft in accordance with Beech Service Manual. Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Compressions: #1 72/80 #2 74/80 #3 75/80 #4 76/80 #5 77/80 #6 75/80. Tighten right tailpipe clamp. Replaced air conditioning compressor belt guard, 36-555048-3. AD2014-05-29 Superior Cylinders, DNA not installed. Washed down, run-up and leak checked. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with a 100 hour inspection and has been found to be in an airworthy condition. _____end_____  Joseph K. Schott, Inspector  Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 Cincinnati, Ohio 45226 513-871-9966 fax 513-871-9261 Sept. 16, 2015 Hobbs: 1960.8 WO# E6619 Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Washed down, run-up and leak checked. _____end_____  Joseph K. Schott, Inspector  Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 Cincinnati, Ohio 45226 513-871-9966 W.O.# E6829 N934PC Beech A-36 S/N E-3448 Date: April 21, 2016 Hobbs:1992.8 AFTT:1992.8 Eng. TT:1992.8 Eng. TSO:214.7 Prop TT:1992.8 Completed inspection this date in accordance with FAR 43 Appendix D. Serviced and lubricated aircraft in accordance with Beech Service Manual. Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Compressions: #1 79/80 #2 75/80 #3 78/80 #4 77/80 #5 78/80 #6 78/80. Removed, cleaned and reinstalled fuel nozzles. Adjust air conditioner compressor belt tension. Washed down, run-up and leak checked. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with a 100 hour inspection and has been determined to be in an airworthy condition. _____end_____  Joseph K. Schott, Inspector

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page

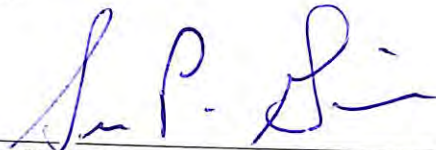


4760 Airport Road, Hangar 6
Cincinnati, Ohio 45226

Certified Repair Station E5ZR316Y
513-871-9966

Date: December 23, 2013 Tail # 934PC W.O. #E5956
HOBBS 1847.9

Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil
And tempest AA48109 filter. Washed down, run-up and leak checked. All
Ground checks performed satisfactory.
End.


Sean P. Gaiser



Certified Repair Station E5ZR316Y
4760 Airport Road, Hangar 6 Cincinnati, Ohio 45226 513-871-9966

W.O.# E6073
N934PC Beech A36
S/N E-3448

Date: May 16, 2014 Tach: 1869.9 AFTT: 1869.9 Engine TT: 1869.9 Engine TSO: 91.8 Prop TT: 1869.9

Completed inspection this date in accordance with FAR 43 Appendix D. Serviced and lubricated aircraft in accordance
with Beech Service Manual. Compressions: #1 78/80 #2 76/80 #3 76/80 #4 77/80 #5 77/80 #6 78/80. Replaced
#5 fuel injection line clamp, 652436-1. Replaced left tailpipe clamps, 35-950004-17. Washed down, run-up and leak
checked. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with a
100 hour inspection and has been found to be in an airworthy condition.-----end-----



Joseph K. Schott, Inspector



Certified Repair Station E5ZR316Y
4760 Airport Road, Hangar 6 513-871-9966 fax 513-871-9261
Cincinnati, Ohio 45226

November 21, 2014 Hobbs:1888.0 W.O.#E6294 N934PC Beech A36

Drained oil and removed oil filter. Serviced with 11 qts. Aeroshell 15W50 oil and Tempest
AA48109 oil filter. Washed down, run-up and leak checked.-----end-----


Joseph K. Schott, Inspector

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page
				 Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 513-871-9966 fax 513-871-9261 Cincinnati, Ohio 45226 Date: March 1, 2013 Hobbs: 1778.1 total time W.O.# E5561 Completed inspection this date in accordance with Beech A36 inspection guide. Replaced induction air filter, P137627, next due @ 2278.1 total time. I certify that this engine has been inspected in accordance with a 100 hour inspection and has been found to be in an airworthy condition. _____end_____  Joseph K. Schott, Inspector
				 Certified Repair Station E5ZR316Y 4760 Airport Road, Hangar 6 513-871-9966 fax 513-871-9261 Cincinnati, Ohio 45226 July 12, 2013 Hobbs: 1809.8 W.O.#E5773 Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil, 1 pt. Camguard and Tempest AA48109 oil filter. Washed down, run-up and leak checked. All ground checks performed satisfactory. _____end_____  Joseph K. Schott, Inspector
				SUB-TOTALS this page
				TOTALS -Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
------	--------------------------------	------------------------------------	---------------------------------------	---

1. Approving National Aviation Authority/Country: FAA / UNITED STATES		2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG		3. Form Tracking Number: Invoice # 7739	
4. Organization Name and Address: SIGNATURE ENGINES, INC., 4760 AIRPORT ROAD, HANGAR 6, CINCINNATI, OHIO 45226 Cert # E5ZR316Y				5. Work Order/Contract/Invoice Number: E5561	
6. Item:	7. Description:	8. Part Number:	9. Eligibility:	10. Quantity:	11. Serial/Batch Number:
1	TELEDYNE CONTINENTAL ENGINE	IO-550-B	N/A	1	685951
12. Status/Work: OVERHAULED					
13. Remarks: THIS ENGINE HAS BEEN OVERHAULED IN ACCORDANCE WITH THE APPLICABLE CONTINENTAL MANUALS. A LIST OF ALL PARTS, F.A.A. AIRWORTHINESS DIRECTIVES AND MANUFACTURER'S SERVICE BULLETINS COMPLIED WITH ARE A PART OF THESE RECORDS. ALL PARTS HAVE BEEN INSPECTED AND HAVE BEEN DETERMINED AIRWORTHY TO RETURN TO SERVICE. ENGINE TEST RUN PER OVERHAUL MANUAL. TEST SHEET FURNISHED. THIS ENGINE IS RETURNED TO SERVICE. PARTS AND ACCESSORIES REPLACED: 6 New Superior Millennium Cylinders 2 New Slick Magnetos 1 New Harness 1 Overhauled Fuel Injection 1 Set of New Spark Plugs T.T.S.N.: 1778.1 Hours T.S.M.O.H.: 0.0 Hours					
14. Certifies the items identified above were manufactured in conformity to: ☐ Approved design data and are in condition for safe operation. ☐ Non-approved design data specified in Block 13.			19. ☒ 14 CFR 43.9 Return to Service ☐ Other regulation specified in Block 13 Certifies that unless otherwise specified in block 13, the work identified in Block 12 and described in Block 13 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.		
15. Authorized Signature:		16. Approval/Authorization No.:		20. Authorized Signature:	
17. Name (Typed or Printed):		18. Date:		22. Name (Typed or Printed): Terrence McRoberts, Inspector	
				21. Approval/Certificate No.: E5ZR316Y	
				23. Date (m/d/y): February 18, 2013	
User/Installer Responsibilities It is important to understand that the existence of this document alone does not automatically constitute authority to install the part/component/assembly. Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness accepts parts/components/assemblies from the airworthiness authority of the country specified in Block 1. Statements in Blocks 14 and 19 do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.					

FAA Form 8130-3 (6-01)

* Installer must cross-check eligibility with applicable technical data.

NSN: 0052-00-012-9005



4760 Airport Road, Hangar 6
Cincinnati, Ohio 45226

Certified Repair Station E5ZR316Y
Phone 513-871-9966

Date: February/18/2013 Model: IO-550-B S/N:685951 W.O. #E5561
T.S.M.O.H. O.O HR Total Time Engine: 1778.1 Hours Hobbs:1778.1
THIS ENGINE HAS BEEN INSTALLED IN AIRCRAFT N934PC WITH THE
FOLLOWING PARTS AND ACCESSORIES:

6 New Superior Millennium Cylinder	New Gamijector	New Induction Air Duct
2 New Slick Magnetos	4 New Sets of Engine Mounts	
1 New Harness	New A/C Belt	Prop Resealed
1 Overhauled Fuel Injection	New Quick Drain	New Fuel Servo cooling duct
1 Set of New Spark Plugs	New Flex Fuel and Oil Lines	

ALL MAINTENANCE RELEASE TAGS ARE IN FOLDER IN BACK OF THESE RECORDS.

Joseph K. Schott, Inspector

SUB-TOTALS this page

TOTALS-Carry forward to next page

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

[illegible]

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

[illegible]

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

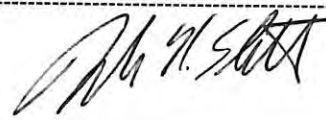
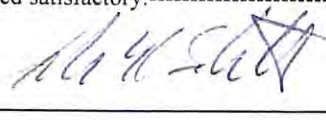
Reg # _____ Owner's Name _____

DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED		INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS				
				 Aviation Services OF CINCINNATI 4696 Airport Rd. Hangar 2 Lunken Airport Cincinnati, OH 45226 513-871-6222 jschott@avservicescinci.com		N934PC Beech A36 E-3448 5-9-2011 Hobbs 1660.2 AFTT Eng. TT 1660.2 Prop. TT 1660.2	
				Completed inspection this date in accordance with Beech 36 Maintenance Manual. Inspected Intake, exhaust, and ignition systems. Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Compressions: #1 70/80 #2 73/80 #3 75/80 #4 74/80 #5 74/80 #6 74/80. Cleaned fuel nozzles. Cleaned gapped and tested spark plugs. Washed down, run-up and leak checked. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with an annual inspection and has been found to be in an airworthy condition.-----end----- Joseph K. Schott A&P272464269IA			
				 Aviation Services OF CINCINNATI 4696 Airport Rd. Hangar 2 Lunken Airport Cincinnati, OH 45226 513-871-6222 jschott@avservicescinci.com		N934PC Beech A36 1-24-2011 Hobbs 1655.6	
				Drained oil and removed oil filter. Serviced with 11 quarts Aeroshell 15W50 oil and Tempest AA48109 oil filter. Washed down, run-up and leak checked.-----end----- Joseph K. Schott A&P272464269			

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____




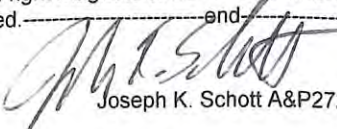
Reg # _____ Owner's Name _____

DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS			
				 Avionics, Inc. 4696 Airport Rd. Hangar 2 Lunken Airport Cinti, OH 45226 513-871-6222 joesavionics@zoomtown.com	N934PC Beech A36 S/N E-3448 5-14-2010 Hobbs 1588.0 AFTT Engine TT 1588.0 Propeller TT 1588.0	
				Completed inspection this date in accordance with Beech Maintenance Manual. Inspected intake, exhaust and ignition systems. Drained oil and removed oil filter. Serviced with 11 qts. Aeroshell 15W50 oil and Tempest AA48109 oil filter. Compressions: #1 74/80 #2 69/80 #3 73/80 #4 74/80 #5 73/80 #6 76/80. Master orifice 69 psi. Induction air filter due for replacement @ 1827.2 AFTT or 3-2013 whichever occurs first. Replaced right magneto base gasket. Reset magneto timing. Inspected heat muffler. Removed, cleaned and reinstalled fuel nozzles. Ty-wrapped lines on right rear intake pipe. Ty-wrapped compressor clutch wire. Tighten left tailpipe clamp. Washed down, run-up and leak checked. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with an annual inspection and has been determined to be in an airworthy condition.-----end-----		
				 Joseph K. Schott A&P272464269IA		
				 Aviation Services OF CINCINNATI 4696 Airport Rd. Hangar 2 Lunken Airport Cinti, OH 45226 513-871-6222 joesavionics@zoomtown.com	N934PC Beech A-36 s/n E-3448 10-22-2010 Hobbs 1622.3	
				Removed alternator 649304 s/n 002BA003 for repair, sent to Modified Aircraft Accessories. Reinstalled with new gasket after overhaul, see, FAA Form 8130-3 for more details. Run-up, ops checked satisfactory.-----end-----		
				 Joseph K. Schott A&P272464269		

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS			
				L&M Aircraft Inc. Rome, GA 30165 N934PC Raytheon A36 L-3448 Hobbs 1455.0 December 15, 2008 Performed differential compression check @ 80 Psi. #1-68. #2.-67. #3-69. #4-58. #5-67. #6-67. Mitchell Todd Bone A&P 255653270		
				Avionics, Inc. 4696 Airport Rd. Cincinnati, Ohio 45226 513-871-6222 1-21-2009 Hobbs 1460.4 Drained oil and removed filter. Serviced with 10 qts. Aeroshell 15W50 oil and Champion CH48109-1 oil filter. Tighten right tailpipe clamp. Washed down, run-up and leak checked.-----end-----		Joseph K. Schott A&P272464269
				Avionics, Inc. 4696 Airport Rd. Cincinnati, Ohio 45226 513-871-6222 April 17, 2009 Hobbs 1468.4 TTAF and engine Completed inspection this date per Beech Inspection Guide. Inspected intake, exhaust and ignition systems. Compressions: #1 64/80 #2 68/80 #3 66/80 #4 62/80 #5 65/80 #6 68/80. Checked engine controls for travel and security. Cleaned, gapped and tested spark plugs. Tightened right exhaust tailpipe clamp. Stop drilled crack in engine baffle above oil cooler. Removed broken staple in left baffle side tray and replaced with safety wire. All ground checks performed satisfactory. I certify that this engine has been inspected in accordance with a 100 hour inspection and has been determined to be in an airworthy condition.----- -----end-----		Joseph K. Schott A&P272464269
				Avionics, Inc. 4696 Airport Rd. Cincinnati, Ohio 45226 513-871-6222 N934PC Beech A36 Hobbs 1515.7 Drained oil and removed oil filter. Serviced with 11 qts. Aeroshell 15W50 oil and Champion CH48109-1 oil filter. Checked magneto timing. Adjusted right magneto to 22° BTDC. Washed down, run-up and leak checked.-----end-----		Joseph K. Schott A&P272464269

MAINTENANCE/INSPECTION ENTRIES

18

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS			



Corporate Eagle
COMPANIES

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 5-16-08 1357.9 TT ----TSO 1357.9 Hobbs.

Changed oil and filter with Phillips 20W50 and CH48109 filter.
This Engine has been inspected in accordance with a 50Hr. inspection and is approved
for return to service as of this date and time. Details are on file at this facility under work
order #2027.

A&P 58922832



Corporate Eagle
COMPANIES

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 8-19-08 1410.4 TT ----TSO 1410.4 Hobbs.

Changed oil and filter with Phillips 20W50 and CH48109 filter.
This Engine has been inspected in accordance with a 50Hr. inspection and is approved
for return to service as of this date and time. Details are on file at this facility under work
order #2029.

A&P 58922832

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

[illegible]

**6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport**

N934PC

Date: 3-05-08 1327.7 TT ----TSO 1327.7 Hobbs.
Engine compression; #1 59 #2 64 #3 64 #4 56 #5 66 #6 64 IAW SB03-3 41psi being the lowest acceptable.
AD2007-04-19R1 Superior air parts inc. cast cylinder assemblies. N/A factory new engine and no cylinders replaced.
AD2007-16-10 Turbocharger compressor rotor. N/A by engine model.
Changed oil and filter with Phillips 20W50 and CH48109 filter.
This Engine has been inspected in accordance with an ANNUAL inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #2021.

A&P 559227832 ZA

[illegible]

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE	TIME	ENTRIES MAY BE ON MULTIPLE	INSPECTOR'S	LICENSE
Y M D	HOURS	LINES IF REQUIRED	SIGNATURE	NUMBER



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport


N934PC

Date: 8-14-07 1253.2 TT ----TSO 1253.2 Hobbs

Removed propeller to remove leaking crankshaft seal. Removed crankshaft seal and installed new seal. Installed propeller with new hardware and torqued to 75ft.lbs. Ran engine and checked for leaks. No leaks noted.

Changed oil and filter with Phillips 20W50 and CH48109 filter.

This Engine has been inspected in accordance with a 50Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1991.

 A&P 589227832




6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 10-18-07 1304.7 TT ----TSO 1304.7 Hobbs

Changed oil and filter with Phillips 20W50 and CH48109 filter.

This Engine has been inspected in accordance with a 50Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #2004.

 A&P 589227832

MAINTENANCE/INSPECTION ENTRIES

14

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME		ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D		HOURS			



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 09-29-06 1117.9TT ----TSO 1117.9Hobbs
Removed starter adapter assembly P/N 642087A59 S/N 1193 and sent to Aircraft Accessories for overhaul. (See Form 8130-3). Installed overhauled assembly using all new loc washers and nuts. Installed new A/C belt and adjusted tension. Reinstalled starter with new o-ring and nuts. All nuts torqued to specified values in Bonanza maintenance manual and Continental engine manual. Reinstalled various baffling and battery box and battery.

[Signature]

A&P 5892282



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 1-3-07 1147.9TT ----TSO 1147.9Hobbs
Changed oil and filter with Phillips 20W50 and CH48109 filter.
This Engine has been inspected in accordance with a 50Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1947.


[Signature]

A&P 3160865

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS			
 Tradewinds Aviation <i>"the professional approach"</i>				6320 Highland Road Waterford, Mi. 48327 Oakland County International Airport <u>N934PC</u>		
Date: 07-13-06 1055.2TT ----TSO 1055.2Hobbs Changed oil and filter with Phillips 20W50 and CH48109 filter. This Engine has been inspected in accordance with a 50Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1911.				 A&P <u>58922802</u>		
 Tradewinds Aviation <i>"the professional approach"</i>				6320 Highland Road Waterford, Mi. 48327 Oakland County International Airport <u>N934PC</u>		
Date: 08-24-06 1106.3TT ----TSO 1106.3Hobbs Changed oil and filter with Phillips 20w50 and CH48109 filter. This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1925.				 A&P <u>2739813</u>		

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME		ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D		HOURS			

*"the professional approach"*

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 03-17-06 927.1TT ----TSO 927.1Hobbs

Removed and cleaned fuel injection nozzles. Installed nozzles back into appropriate cylinders. Engine comp. #1 64 #2 64 #3 68 #4 62 #5 52 #6 68 IAW SB03-3 minimum acceptable 42.

Changed oil and filter with Phillips 20W50 and CH48109 filter.

This Engine has been inspected in accordance with an ANNUAL inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1880.

[Signature] A&P 58922832 FA

*"the professional approach"*

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 05-10-06 982.7TT ----TSO 982.7Hobbs

Changed oil and filter with Phillips 20W50 and CH48109 filter.

This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1894.

[Signature] A&P 2779813

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME		ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	H	OURS			



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 08-11-05 823.4TT ----TSO 823.4Hobbs
Changed oil and filter with Philips 20W50 and CH48109 filter.
This Engine has been inspected in accordance with a 50HR inspection and is approved
for return to service as of this date and time. Details are on file at this facility under work
order #1837.

A&P 2739813



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 10-26-05 870.3TT ----TSO 870.3Hobbs
Changed oil and filter with Philips 20W50 and CH48109 filter.
This Engine has been inspected in accordance with a 50 Hr. inspection and is approved
for return to service as of this date and time. Details are on file at this facility under work
order #1856.

A&P 2739813

Reg # _____ Owner's Name _____

10

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME		ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D		HOURS			



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 02-22-05 647.3TT ----TSO 647.3Hobbs

Changed oil and filter with Aeroshell W65 and CH48109 filter.

This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1792.

A&P 2739813



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 04-08-05 694.2TT ----TSO 694.2Hobbs

Changed oil and filter with Aeroshell W65 and CH48109 filter.

This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1800.

A&P 2739813

MAINTENANCE/INSPECTION ENTRIES

08

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 09-24-04 551.6TT ----TSO 551.6Hobbs
Changed oil and filter with Aeroshell W100 and CH48109 filter.
This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1762.

[Signature] A&P 38176553

SE
ER



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 11-24-04 593.6TT ----TSO 593.6Hobbs
Changed oil and filter with Aeroshell W65 and CH48109 filter.
This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1777.

[Signature] A&P 58927782

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE	TIME	ENTRIES MAY BE ON MULTIPLE	INSPECTOR'S	LICENSE
YEAR	HOURS	LINES IF REQUIRED	SIGNATURE	NUMBER



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 07-02-04 452.7TT ----TSO 452.7Hobbs

Changed oil and filter with Aeroshell W100 and CH48109 filter.

This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1738.

[Signature] A&P 38176553



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 08-09-04 500.3TT ----TSO 500.3Hobbs

Changed oil and filter with Aeroshell W100 and CH48109 filter.

This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1750.

[Signature] A&P 38176553

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS			



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 05-11-04 401.4TT ---TSO 401.4Hobbs

Engine compressions: #1 60 #2 62 #3 60 #4 62 #5 60 #6 62 IAW SB03-3

Changed oil and filter with Aeroshell W100 and CH48109 filter.

This Engine has been inspected in accordance with an ANNUAL inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1721.

A&P 58922832FA



6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 05-11-04 401.4TT 401.4 Hobbs

AD2004-08-10 Does not apply due to cylinders in question not installed

A&P 58922832

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model A-36 Serial Number E-3448
 Reg # N934PC Owner's Name FO-550 B3917
S/W 685951

DATE			TIME		ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D		HOURS			



6320 Highland Road
 Waterford, Mi. 48327
 Oakland County International Airport

N934PC

Date: 03-10-04 337.8TT ----TSO 337.8Hobbs

Changed oil and filter with Aeroshell W65 and CH48109 filter.

This Engine has been inspected in accordance with a 50 Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1704.

A&P 589227832



6320 Highland Road
 Waterford, Mi. 48327
 Oakland County International Airport

N934PC

Date: 04-19-04 390.4TT ----TSO 390.4Hobbs

Changed oil and filter with Aeroshell W100 and CH48109 filter.

This Engine has been inspected in accordance with a 50 Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1714.

A&P 589227832

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME		ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS				

*"the professional approach"*

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 09-03-03 221.5TT ----TSO 221.5Hobbs

Changed oil and filter with Aeroshell W100 and CH48109 filter.

This Engine has been inspected in accordance with a 50 Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1665.

A&P

38176553

*"the professional approach"*

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 11-12-03 281.6TT ----TSO 281.6Hobbs

Changed oil and filter with Aeroshell W65 and CH48109 filter.

This Engine has been inspected in accordance with a 50 Hr. inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1682.

A&P

58922832

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____

Reg # _____ Owner's Name _____

DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS			



"the professional approach"

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 07-11-02 50.3TT 50.3Hobbs

Installed oil pressure switch at firewall on left side. Aircraft Hobbs now runs off of oil pressure switch instead of landing gear switch.

A&P 58922802



"the professional approach"

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 10-01-02 98.1TT 98.1Hobbs

Changed oil and filter with Aeroshell W100 and CH48109 filter.

This Engine has been inspected in accordance with a 50HR inspection and is approved for return to service as of this date and time. Details are on file at this facility under work order #1578.

A&P 381765953



"the professional approach"

6320 Highland Road
Waterford, Mi. 48327
Oakland County International Airport

N934PC

Date: 01-30-03 127.0TT ---TSO 127.0Tach Hobbs

Changed oil and filter with Aeroshell 65W oil and CH48109 oil filter.
Leak check good.

A&P 381765953

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model A36 Serial Number E-3448
 Reg # N934PC Owner's Name CONTINENTAL IO-550 B39B
S/N 685951

DATE			TIME		ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D		HOURS			



6320 Highland Road
 Waterford, Mi. 48327
 Oakland County International Airport

N934PC

Date: 05-14-02 16.1TT 000.0TSO 16.1HOBBS

Opened this engine logbook.

A&P 589227832



6320 Highland Road
 Waterford, Mi. 48327
 Oakland County International Airport

N934PC

Date: 05-28-02 19.0TT 19.0Hobbs

Drained factory oil from engine and removed oil filter. Serviced engine with 12 quarts
 Aeroshell 100 straight mineral oil and installed a new CH48109 oil filter.

A&P 361765953



6320 Highland Road
 Waterford, Mi. 48327
 Oakland County International Airport

N934PC

Date: 7-11-02 50.3TT 50.3Hobbs

Changed oil and filter with Aeroshell W100 and CH48109 filter.

This Engine has been inspected in accordance with a 50HR inspection and is approved
 for return to service as of this date and time. Details are on file at this facility under work
 order #1548.

A&P 589227832

CONTINENTAL
IO-550B39B
S/N 685951

ENGINE LOG BOOK

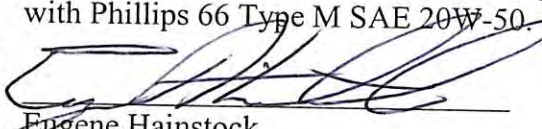



CONTINENTAL MOTORS

Engine Service and Maintenance Record

Installations, Inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins

This engine has been installed on aircraft serial number E-3448 and has been fully charged with Phillips 66 Type M SAE 20W-50.


Eugene Hainstock
FOR RAYTHEON AIRCRAFT CO. PC#8

5/14/02 16.1 — — CLOSED THIS LOG-BOOK.  A1658522782

Service Bulletins and Technical Publications are available on a direct mail basis from the factory. Orders must be prepaid. Send for order form or call 334-438-3411, publications department, for information.

Engine Returns

All returned engines are to be shipped with this log book
Directly to:

Teledyne Continental Motors
Abbeville Industrial Park
Suite 159
Abbeville, AL 36310

USE ONLY FUEL CONFORMING TO ASTM D910
USE OF AUTOMOTIVE GAS IS NOT APPROVED.

This engine model I0550B39B, Serial Number 685951
was manufactured on 3-02-02 by Teledyne Continental
Motors in accordance with approved design data and the applicable requirements of
Part 21 of the Federal Aviation Regulation. The approved design data for this engine
incorporates all changes required by applicable Airworthiness Directives and Teledyne
Continental Motors Service Bulletins.



TELEDYNE CONTINENTAL MOTORS
A TELEDYNE TECHNOLOGIES COMPANY