

N269JJ LOGBOOK 2

AS OF 11/2022

**AIRCRAFT LOG**  
**AF5-1**



10035 (06-14-2024)

Page 1 / 1

MAKE: Cirrus Design Corp  
MODEL: SR20  
S/N: 2487  
REG. NO: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

W/O #: 10035  
DATE: 06-14-2024  
A/C TT: 1745.0  
A/C Tach: 1745.0

**Airframe Entries**

Removed failed recirculation motor and replaced with new. Performed operational check of same, no defects noted.

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 06-14-2024

SIGNED:

Darion McFadden  
A&P or IA Number: 4138120

WORK ORDER: 10035

Printed by EBIS (EBISCloud.com)

10044 (06-25-2024)

Page 1 / 1

MAKE: Cirrus Design Corp  
MODEL: SR20  
S/N: 2487  
REG. NO: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

W/O #: 10044  
DATE: 06-25-2024  
A/C TT: 1759.2  
A/C Tach: 1759.2

**Airframe Entries**

Troubleshoot MFD not turning on and burning smell in cockpit. Removed both GDUs, GIAs, and GEA, found no evidence of electrical failure or damage to any avionics components. Re-installed LRUs and ran avionics on ground power for an extended period of time, could not duplicate discrepancy.

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 06-25-2024

SIGNED:

Darion McFadden  
A&P or IA Number: 4138120

WORK ORDER: 10044

Printed by EBIS (EBISCloud.com)

**Airframe Logbook Entry**

**Paragon Aircraft Service, Inc.**

19 Wright Way, Fairfield, NJ 07004  
Phone: (973)575-0364 Fax (973)244-1884

Authorized  
Cessna Service  
Center

| Date     | N' Number | Make/Model   | Serial# | FLT:   | Hobbs  | Total Time | W. O. |
|----------|-----------|--------------|---------|--------|--------|------------|-------|
| 8/5/2024 | N269JJ    | Cirrus SR 20 | 2487    | 1762.5 | 2182.6 | 1762.5     | 11969 |

Removed parachute reefing line cutters P/N 26707-001, Mfg date 08/18, S/N's 14478 and 14557. Installed new reefing line cutters P/N 26707-001, Mfg Date 04/24, S/N's 25359 and 25323. Next replacement due 04/2030. Removed pitch trim tab. Removed surface corrosion from elevator skin at trim tab faying surface. Alodined, primed, and painted treated area and reinstalled trim tab.

I certify that the work described above was performed satisfactorily and in accordance with approved/acceptable data and is approved for return to service with regard to work performed.

Authorized Signature:

Stephen Dooley A&P 153549117

MAKE: Cirrus  
MODEL: SR20  
S/N: 2487  
REG. NO: N269JJ



**Cirrus McKinney Service Center**  
Repair Station No. CDOR140E  
1500 Industrial Blvd  
Hangar #19  
McKinney, TX 75069

W/O #: KTKI4306-09-2024  
DATE: 10-03-2024  
Flight Time: 1783.4  
Hobbs: 2213.2

**Airframe Entries**

Replaced LH wing tip assembly with new wing tip assembly P/N 38513-003 IAW SR20 MM Ch 57-20. Ops checks good.

I have reviewed the file on this aircraft and the accompanying discrepancy forms. The aircraft, airframe, aircraft engine, propeller or component(s) identified was repaired/inspected in accordance with current requirements of the Federal Aviation Administration and is approved for return to service. Pertinent details of this work order are on file at this Certified Repair Station CRS# CDOR140E.

DATE: 10-03-2024

SIGNED:

James Brown  
Repair Station No. CDOR140E

WORK ORDER: KTKI4306-09-2024  
Printed by EBIS (EBISCloud.com)

# AIRWORTHINESS DIRECTIVE/FACTORY BULLETIN COMPLIANCE RECORD

| A.D./BULL. NU | ITEM | DATE & HRS. | METHOD OF | TYPE OF A.D. | NEXT COMP. | AUTHORIZED SIGNATURE |
|---------------|------|-------------|-----------|--------------|------------|----------------------|
|---------------|------|-------------|-----------|--------------|------------|----------------------|

7592 (04-09-2024)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

Page 1 1

W/O #: 7592  
DATE: 04-09-2024  
A/C TT: 1670.7  
A/C Tach: 1670.7

### Airframe Entries

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2024-06.  
\*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.

- \*Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20.
- \*Serviced brake fluid reservoir IAW Cirrus AMM 12-10.
- \*Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.
- \*C/W ICA Concorde Sealed Battery, no defects noted.
- \*C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date MAY/2025.... Removed worn LMLG and RMLG brake linings and replaced with new.... Repaired cracked LH side rear baffle.... Removed cracked compressor bolt shim and replaced with new.... Removed worn LMLG tire and replaced with new.... Removed worn RMLG tire and replaced with new.... Removed delaminated center console overlay and replaced with new.... Removed cracking LH CAPS exterior warning placard and replaced with new.... Removed cracking RH CAPS exterior warning placard and replaced with new.... Removed cracking LH wing fuel cap placard and replaced with new.... Removed bubbling RH fuel cap placard and replaced with new.... Removed mount bonding straps and replaced with new.... Removed worn governor control cable and brackets and replaced with new.... Removed both frayed engine baffle with new.... Applied tape to pilot seat bottom fabric. No further defects noted.... Replaced cracked aft LH engine Re-installed missing nut plate on LMLG mushroom fairing.... Applied tape to co-pilot seat bottom fabric. No further defects noted.... defects noted.... Removed worn GPS antenna sealant and replaced with new.... Removed delaminated pilot seat energy absorption module and replaced with new.... Removed delaminated co-pilot seat energy absorption module and replaced with new.... Removed nose fork assembly, cleaned and re-installed with new grease and hardware. Set nose fork to proper tension per CAMM.... Removed snapped spring from air mixing chamber relief valve and replaced with new.

### Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 04-09-2024

SIGNED:

Jesse Cardinale  
A&P or IA Number: 4534204

WORK ORDER: 7592

Printed by EBIS (EBISCloud.com)

7592 (04-09-2024)

Page 1 / 1

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

W/O #: 7592  
DATE: 04-09-2024  
A/C TT: 1670.7  
A/C Tach: 1670.7

### Annual Entries

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection using the Cirrus Aircraft SR-20 AMM Chapter 05-20 inspection Checklist and was determined to be in an airworthy condition. AD's checked through this date: 2024-06, c/w all AD's due this inspection.

### Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 04-09-2024

SIGNED:

Daron McFadden  
A&P or IA Number: 4138120

WORK ORDER: 7592

Printed by EBIS (EBISCloud.com)

10013 (05-13-2024)

Page 1 / 1

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG NO: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735

W/O #: 10013  
DATE: 05-13-2024  
A/C TT: 1725.3  
A/C Tach: 1725.3

### Airframe Entries

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2024-09.

- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \*Performed airframe 50 hr inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20.
- \*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.... Replaced air mixing chamber with new. Performed operational check of same, no defects noted.... Removed warped LMLG wheel, and replaced with new using new tire.

### Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 05-13-2024

SIGNED:

Syed Rafay Hossain  
A&P or IA Number: 4521770 4521779

WORK ORDER: 10013

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO.: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

W/O #: 7516  
DATE: 11-09-2023  
A/C TT: 1571.6  
A/C Tach: 1571.6

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2023-22.

\*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.

\*Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.

\*Serviced gascolator IAW Cirrus AMM 28-20.

\*Serviced brake fluid reservoir IAW Cirrus AMM 12-10.

\*Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.

\*C/W ICA Concorde Sealed Battery, no defects noted.

\*C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date MAY/2025.... Removed worn LMLG and RMLG brake linings and replaced with new.... Removed sheared bolt in aft LH engine baffle and replaced with new.... Removed #2 Batteries and replaced with new.... Removed induction air filter and replaced with new.... Replaced broken co-pilot cup holder with new.... Removed worn cowl seal tape from top cowling and replaced with new.... Serviced NLG oleo strut with nitrogen and fluid to proper levels per CAMM, no defects noted.

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 11-09-2023

SIGNED:

JHC  
Jesse Cardinalo  
A&P or IA Number: 4534204

WORK ORDER: 7516

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO.: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

W/O #: 7516  
DATE: 11-10-2023  
A/C Tach: 1571.6  
A/C TT: 1571.6

**Annual Entries**

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date: 2023-22. c/w all AD's due this inspection.

I certify that this AIRCRAFT including airframe, engine and propeller, has been inspected in accordance with an ANNUAL inspection as outline in FAR 43 appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all ad's due this inspection

DATE: 11-10-2023

SIGNED:

Danon McFadden  
A&P or IA Number: 4138120

WORK ORDER: 7516

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO.: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

W/O #: 7556  
DATE: 01-27-2024  
A/C TT: 1618.2  
A/C Tach: 1618.2

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2024-01.

\*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.

\*Performed airframe 50 hr inspection IAW Cirrus AMM 5-20.

\*Serviced gascolator IAW Cirrus AMM 28-20.

\*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.... Removed leaking NLG oleo strut (P/N: 27057-002, S/N off: 0320-83, S/N on: 1023-26) and replaced with new. ... Repaired broken co-pilot cup holder.... Removed worn LMLG tire and replaced with new.... Filled in chipped Bondo, sanded, painted, and polished.

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 01-27-2024

SIGNED:

Danon McFadden  
A&P or IA Number: 4138120

WORK ORDER: 7556

Printed by EBIS (EBISCloud.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO.: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

W/O #: 7572  
DATE: 02-21-2024  
A/C TT: 1636.9  
A/C Tach: 1636.9

**Airframe Entries**

Removed worn LMLG tire and replaced with new.... Removed worn RMLG tire and replaced with new.... Removed broken outboard static wick from right wing and replaced with new.

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 02-21-2024

SIGNED:

Syed Rafay Hossain  
A&P or IA Number: 4521779

WORK ORDER: 7572

Printed by EBIS (EBISCloud.com)



MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7383



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 4/20/2023  
A/C TSN 1451 3  
TACH 1451 3

**Airframe Entries**

Replaced missing left aileron gap seal with new.

**Maintenance Release**

This aircraft engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 4/20/2023

SIGNED:

Danon McFadden, A&P 4138120

Work Order: 7383

Printed by EBIS 3 (dalcomedia.com)

7391 (07-29-2023)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO.: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

Page 1 / 1

W/O #: 7391  
DATE: 07-29-2023  
A/C Tach: 1473.9  
A/C TT: 1473.9

**Airframe Entries**

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date: 2023-14. c/w all AD's due this inspection.

I certify that this AIRCRAFT including airframe, engine and propeller, has been inspected in accordance with an ANNUAL inspection as outline in FAR 43 appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all ad's due this inspection

DATE: 07-29-2023

SIGNED:

Danon McFadden  
A&P or IA Number: 4138120

WORK ORDER: 7391

Printed by EBIS (EBISCloud.com)

# AIRWORTHINESS DIRECTIVE/FACTORY BULLETIN COMPLIANCE RECORD

7391 (07-24-2023)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO.: N269JJ



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735

Page 1 / 1

W/O #: 7391  
DATE: 07-24-2023  
A/C TT: 1473.9  
A/C Tach: 1473.9

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2023-14.

- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \*Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20.
- \*Serviced brake fluid reservoir IAW Cirrus AMM 12-10.
- \*Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.
- \*C/W ICA Concorde Sealed Battery, no defects noted.
- \*C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 05/2025.... Removed worn LMLG and RMLG brake linings and replaced with new.... Performed 500 hour inspection on alternator #1. Replaced brush holder assembly.... Performed 500 hour inspection on alternator #2. Replaced brush holder assembly.... Replaced both #2 batteries (P/N: 50979-001) with new. Performed an operational check of same, no defects noted.... Removed worn cowl seal tape from top cowling and replaced with new.... Removed broken compressor line bracket and replaced with new.... Serviced NLG oleo strut with nitrogen and fluid to proper levels per CAMM, no defects noted.... Removed inboard exhaust hangar bracket and replaced with new.... Removed loose lower right engine mount bonding strap and replaced with new.... Removed alternator #2 mount and replaced with new.... Removed A/C compressor tension bracket and replaced with new.... Updated FSS10 firmware to version 2.71, performed operational check of same, no defects noted.... Removed broken cup holder from pilot side, and replaced with new.... Re-inserted sticking arm rest pin.... Removed RH sun visor, retightened sun visor base and reinstalled sun visor. Performed an operational check of the same, no defects noted.... Removed LH sun visor, retightened sun visor base and reinstalled sun visor. Performed an operational check of the same, no defects noted.... Re-tightened ignition switch. Performed an operational check of the same, no defects noted.... Removed deteriorating sealant on WAAS GPS antenna and replaced with new.... Installed new engine control fnction knob.... Removed fresh air duct and replaced with new.... Cleaned and lubricated flap attach rod ends. No defects noted.... Removed nose fork assembly and replaced with new.... Replenished A/C refrigerant and performed leak check of same. No defects noted.... Removed damaged cylinder #2 lower exhaust header and replaced with new.... Removed damaged cylinder #4 lower exhaust header and replaced with new.... Upon inspection, found that the black rubber anti-rattle plugs in the AmSafe seat belt buckle on the co-pilot seat is missing. Replaced missing black rubber anti-rattle plug.... Removed fuel flow sensor and replaced with new.... Removed and replaced avionics cooling fan with new. Performed operational check of same, no defects noted.... C/W Cirrus SB2X-42-23, Perspective+ S/W Update v2647.N9, by updating and configuring new software. Performed operational check of same, no defects noted.

**Maintenance Release**

This aircraft engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 07-24-2023

SIGNED:

Jesse Cardinale  
A&P or IA Number: 4534204

WORK ORDER: 7391

Printed by EBIS (EBISCloud.com)

# LIFE LIMITED PARTS OR OVERHAUL REQUIREMENTS

| NAME OF PART   | PART NUMBER | SERIAL NUMBER | INSTALLATION DATE/HOURS | TIME ON PART AT INSTALL | LIFE LIMIT OR T.B.O. | REMOVAL DATE/HOURS | AGENCY CERT. NO. |
|--|-------------|---------------|-------------------------|-------------------------|----------------------|--------------------|------------------|
| <p style="text-align: center;"><b>VENTURA</b> <span style="float: right;">W/O: <u>23A019</u> Reg. <u>N269JJ</u></span></p> <p>Date <u>4/6/20 23</u> Fech <u>1444.5</u> Alt <u>18000</u><br/>                     Repairman <u>Mario Cabrera</u> # <u>IDDR252K</u></p> <p>Altimeter System Test And Inspection<br/>                     Model/Type <u>G600/WK/GDC-#1/S/N 3KY00318</u><br/>                     Certified Inspected in accordance with Part 43, App. E and found airworthy Ventura Repair Station # IDDR252K</p> <p>Transponder System Test And Inspection<br/>                     Model <u>6TX74SR</u> S/N <u>3EH023283</u><br/>                     Certified Inspected in accordance with Part 43, App. F and found airworthy Ventura Repair Station # IDDR252K</p> <p style="text-align: center;"><input type="checkbox"/> VFR ONLY<br/><input checked="" type="checkbox"/> IFR</p> <p style="text-align: center;"><b>VENTURA</b> <span style="float: right;">W/O: <u>23A019</u> Reg. <u>N269JJ</u></span></p> <p>Date <u>4/6/20 23</u> Fech <u>1444.5</u> Alt <u>18000</u><br/>                     Repairman <u>Mario Cabrera</u> # <u>IDDR252K</u></p> <p>Altimeter System Test And Inspection<br/>                     Model/Type <u>G600/WK/GDC-#2/S/N 3KY003089</u><br/>                     Certified Inspected in accordance with Part 43, App. E and found airworthy Ventura Repair Station # IDDR252K</p> <p>Transponder System Test And Inspection<br/>                     Model _____ S/N _____<br/>                     Certified Inspected in accordance with Part 43, App. F and found airworthy Ventura Repair Station # IDDR252K</p> <p style="text-align: center;"><input type="checkbox"/> VFR ONLY<br/><input checked="" type="checkbox"/> IFR</p> |             |               |                         |                         |                      |                    |                  |

# LIFE LIMITED PARTS OR OVERHAUL REQUIREMENTS

| NAME OF PART  | PART NUMBER | SERIAL NUMBER | INSTALLATION DATE/HOURS | TIME ON PART AT INSTALL | LIFE LIMIT OR T.B.O. | REMOVAL DATE/HOURS | AGENCY CERT. NO. |
|---|-------------|---------------|-------------------------|-------------------------|----------------------|--------------------|------------------|
| <p style="text-align: center;"><b>VENTURA</b> <span style="float: right;">W/O: <u>23A019</u> Reg. <u>N269JJ</u></span></p> <p>Date <u>4/6/20 23</u> Fech <u>1444.5</u> Alt <u>18000</u><br/>                     Repairman <u>Mario Cabrera</u> # <u>IDDR252K</u></p> <p>Altimeter System Test And Inspection<br/>                     Model/Type <u>ANALOG</u> S/N _____<br/>                     Certified Inspected in accordance with Part 43, App. E and found airworthy Ventura Repair Station # IDDR252K</p> <p>Transponder System Test And Inspection<br/>                     Model _____ S/N _____<br/>                     Certified Inspected in accordance with Part 43, App. F and found airworthy Ventura Repair Station # IDDR252K</p> <p style="text-align: center;"><input type="checkbox"/> VFR ONLY<br/><input checked="" type="checkbox"/> IFR</p> |             |               |                         |                         |                      |                    |                  |

# INSTALLED EQUIPMENT

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7310



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 1/12/2023  
A/C TSN 1359 4  
TACH 1359 4

## Airframe Entries

Replaced missing RH aileron gap seal with new (14390-003).

## Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 1/12/2023

SIGNED:

Daron McFadden A&P 4138120

Work Order: 7310

Printed by EBis 3 (datcomedia.com)

ENGINE

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7337



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 2/15/2023  
A/C TSN 1395 7  
TACH 1395 7

## Airframe Entries

Replaced broken LH sun visor with new (P/N: 15050-104). Performed an operational check of the same, no defects noted.

## Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 2/15/2023

SIGNED:

Syed Rafay Hossain A&P 4521779

Work Order: 7337

Printed by EBis 3 (datcomedia.com)

# MAJOR ALTERATIONS

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7321



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 1/30/2023  
A/C TSN 1373 7  
TACH 1373 7

## Airframe Entries

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2023-02.
- Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- Performed airframe 100 hour inspection IAW Cirrus AMM 5-20
- Serviced gascolator IAW Cirrus AMM 28-20
- Serviced brake fluid reservoir IAW Cirrus AMM 12-10
- Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule
- C/W ICA Concorde Sealed Battery, failed capacitance test.
- C/W FAR 91 207 ELT Inspection, no defects noted. ELT Battery expiration date May 2025
- Removed main battery and replaced with new (P/N 30074-001, S/N off: 41139947, S/N on: 41269959). Performed an operational check of the same, no defects noted
- C/W GMU44 Magnetometer Calibration, no defects noted.
- Removed worn LMLG and RMLG brake linings and replaced with new (P/N: 31392-105)
- Removed worn RMLG tire and replaced with new (P/N: 14075-010).
- Disassembled, cleaned, inspected, reassembled NLG fork assembly and set tension per CAMM

## Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 1/30/2023

SIGNED:

Syed Rafay Hossain A&P 4521779

Work Order: 7321

Printed by EBis 3 (datcomedia.com)

# INSTALLED EQUIPMENT

| ITEM      | MANUFACTURER | MODEL | SERIAL NO. |
|-----------|--------------|-------|------------|
| ENGINE    |              |       | R          |
|           |              |       | L          |
| ENGINE    |              |       | R          |
|           |              |       | L          |
| PROPELLER |              |       |            |
| PROPELLER |              |       |            |
| ENGINE    |              |       |            |
| ENGINE    |              |       |            |

MAKE Cirrus Design Corp  
 MODEL Sr20  
 S/N 2487  
 REG NO N269JJ  
 WORK ORDER 7290



**Nassau Flyers**  
 1300 New Hwy  
 Farmingdale NY 11735  
 Phone 631-454-0626

DATE 12/8/2022  
 A/C TSN 1320 9  
 TACH 1320 9

### Airframe Entries

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2022-25
- Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- Performed airframe 50 hr inspection IAW Cirrus AMM 5-20
- Serviced gascolator IAW Cirrus AMM 28-20
- Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10
- Removed snapped LH cabin door latch cable and replaced with new (P/N 33520-001) Performed operational check of same. no defects noted.
- Removed worn LMLG tire and replaced with new (P/N 14075-010).
- Removed chafing bolt and replaced with new (P/N AN6-20)

### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above. this date and times

DATE: 12/8/2022

SIGNED:

Work Order: 7290

Danon McFadden, A&P 4138120

Printed by EBis 3 (datcomedia.com)

# AIRCRAFT DESCRIPTION

MANUFACTURER Cirrus Design

MODEL SR20

DATE OF MFG. Apr 2019

SERIAL NUMBER 2487

REGISTRATION NUMBER N2699J

## Inspection Status (Check one)

REGISTERED OWNER \_\_\_\_\_

STREET ADDRESS \_\_\_\_\_

CITY, STATE, ZIP \_\_\_\_\_

OPERATOR \_\_\_\_\_

STREET ADDRESS \_\_\_\_\_

CITY, STATE, ZIP \_\_\_\_\_

REGISTERED OWNER \_\_\_\_\_

STREET ADDRESS \_\_\_\_\_

CITY, STATE, ZIP \_\_\_\_\_

OPERATOR \_\_\_\_\_

STREET ADDRESS \_\_\_\_\_

CITY, STATE, ZIP \_\_\_\_\_

F.A.R. 91.409 ANNUAL/100 HOUR

F.A.R. 91.409 PROGRESSIVE

F.A.R. 135.419 A.T.C.O.

OTHER

DATE ENTERED \_\_\_\_\_

MAINTENANCE RESPONSIBILITY

N269JJ AIRFRAME LOGBOOK 1

LAST ENTRY 10/28/2022

**AIRCRAFT LOG**  
**AF5-1**

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7242



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 10/26/2022  
A/C TSN 1275 4  
TACH 1275 4

### Airframe Entries

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2022-21
- Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due
- Performed airframe 100 hour inspection IAW Cirrus AMM 5-20
- Serviced gascolator IAW Cirrus AMM 28-20
- Serviced brake fluid reservoir IAW Cirrus AMM 12-10
- Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.
- C/W ICA Concorde Sealed Battery, no defects noted.
- C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 5/2025
- C/W GSM 86 Servo Clutch Adjustment/Test on all autopilot servos, pitch servo clutch failed. No other defects noted
- Removed failed GSM 86 pitch servo clutch and replaced with newly overhauled unit (P/N: 011-01904-00, S/N off: 1GK025352, S/N on: 1GK033545)
- Extracted snapped cable guide post from GSM 86 pitch servo clutch and replaced with new.
- Removed worn LMLG and RMLG brake linings and replaced with new.
- Removed corroded nose wheel bolts and replaced with new
- Removed nose fork assembly, cleaned and re-installed with new grease and hardware. Set nose fork to proper tension per CMM.
- Removed peeling nose strut fairing seal trim and replaced with new
- Replaced throttle rod end with new
- Replaced heat shrink covering on alternate air valve cable
- Removed deteriorating section of windshield sealant and performed a cosmetic re-seal.
- Removed worn "No Step" placard from left wing root fairing, cleaned area and installed new
- Removed worn "Rescue" placard from LH cabin door, cleaned area and installed new.
- Removed worn "Rescue" placard from RH cabin door, cleaned area and installed new.
- Adjusted rudder rod ends to center it on the vertical stabilizer.
- Removed 2 worn cowl seal tapes from bottom cowling and replaced with new
- Removed deteriorating sealant from two antennas on top of fuselage, and re-sealed
- Tightened loose bolt on elevator shimmy damper
- Replaced Intake drain tube with new drain tube
- Replaced fraying pilot seat belt assembly with new. Performed an operational check of the same, no defects noted.
- Replaced broken co-pilot cup holder with new.

### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 10/26/2022

SIGNED:

Danon McFadden, A&P 4138120

Work Order: 7242

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7242



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 10/26/2022  
A/C TSN 1275 4  
TACH 1275 4

### Airframe Entries

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date: 2022-21, c/w all AD's due this inspection

### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 10/26/2022

SIGNED:

Danon McFadden, IA 4138120

Work Order: 7242

Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 7148



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 7/8/2022  
A/C TSN: 1175.8  
TACH: 1175.8

**Airframe Entries**

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 7/8/2022

SIGNED:

John Magnowski, IA: 3273394

Work Order: 7148

Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 7173



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 8/1/2022  
A/C TSN: 1190.7  
TACH: 1190.7

**Airframe Entries**

T/S alternator #2 CB popping and "check current" CAS message showing, found MCU cable terminal at alternator #2 end detached. Crimped new terminal, and performed an ops check, OK for service.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 8/1/2022

SIGNED:

Mohammed Farhanuddin, A&P: 4183289

Work Order: 7173

Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 7142



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 6/27/2022  
A/C TSN: 1163.6  
TACH: 1163.6

**Airframe Entries**

T/S pilot reports nose wheel shimmy. Found fork tension high. Disassembled, cleaned, inspected, reassembled NLG fork assembly and set tension per CMM.  
Removed worn LMLG tire and replaced with new (P/N: 14075-010)  
Removed worn RMLG tire and replaced with new (P/N: 14075-010)

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 6/27/2022

SIGNED:

Mohammed Farhanuddin, A&P: 4183289

Work Order: 7142

Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 7203



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 8/29/2022  
A/C TSN: 1226.7  
TACH: 1226.7

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2022-18.  
Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.  
Performed airframe 50 hr inspection IAW Cirrus AMM 5-20.  
Serviced gascolator IAW Cirrus AMM 28-20.  
Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 8/29/2022

SIGNED:

Daron McFadden, A&P: 4138120

Work Order: 7203

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7110



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 5/25/2022  
A/C TSN 1133 4  
TACH 1133 4

**Airframe Entries**

Ailerons not centering while static. Performed lubrication to both aileron bearings and roll trim cartridge. Ok for service.

**Maintenance Release**

This aircraft engine propeller or component(s) on N259JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times.

DATE 5/25/2022

SIGNED:

Work Order: 7110

John Magnowski A&P 3273394

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7117



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 6/3/2022  
A/C TSN 1141 9  
TACH 1141 9

**Airframe Entries**

Removed broken A/C compressor tension link, repaired and re-installed with new hardware.  
Repaired alternator #2 field ground terminal wire and reinstalled, no defects noted.

**Maintenance Release**

This aircraft engine propeller or component(s) on N259JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times.

DATE 6/3/2022

SIGNED:

Work Order: 7117

Danon McFadden A&P 4138120

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER: 7148



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 7/8/2022  
A/C TSN: 1175.8  
TACH: 1175.8

**Airframe Entries**

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2022-14.
- Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.
- Serviced gascolator IAW Cirrus AMM 28-20.
- Serviced brake fluid reservoir IAW Cirrus AMM 12-10.
- Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.
- CW ICA Concorde Sealed Battery, no defects noted.
- CW FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 05/2025.
- Removed roll servo actuator, performed special inspection, lubricated gearing and reinstalled.
- Removed pitch servo actuator, performed special inspection, lubricated gearing and reinstalled.
- Removed worn LMLG and RMLG brake linings and replaced with new.
- Removed repaired A/C compressor tension link and replaced with new.
- Removed crushed pilot and copilot seat energy absorption module and replaced with new.
- Aileron sticks in left position, performed inspection of all aileron pulleys and push rods for obstructions and wear. No defects noted.
- Lubed all pulleys and push rods in aileron control system cks ok.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times.

DATE: 7/8/2022

SIGNED:

Work Order: 7148

John Magnowski, A&P: 3273394

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7056



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 3/18/2022  
A/C TSN 10766  
TACH 10766

#### Airframe Entries

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition AD's checked through this date, c/w all AD's due this inspection

#### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE 3/18/2022

SIGNED

John Magnowski IA 3273394

Work Order: 7056

Printed by EBIS 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7079



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 4/18/2022  
A/C TSN 11063  
TACH 11063

#### Airframe Entries

Reseated fresh air intake and inspected engine compartment for leaks. No leaks found Aircraft was ran and no CO2 warning illuminated  
Removed broken grounding strap and replaced with new (P/N MS25083-6BB6)

#### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE 4/18/2022

SIGNED

John Magnowski A&P 3273394

Work Order: 7079

Printed by EBIS 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7098



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 5/13/2022  
A/C TSN 11197  
TACH 11197

#### Airframe Entries

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2022-10  
\*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due  
\*Performed airframe 50 hr inspection IAW Cirrus AMM 5-20  
\*Serviced gascolator IAW Cirrus AMM 28-20  
\*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10  
Removed worn LMLG tire and replaced with new (P/N 14075-010)  
Removed worn RMLG tire and replaced with new (P/N 14075-010)

#### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE 5/13/2022

SIGNED

Mohammed Farhanuddin A&P 4183299

Work Order: 7098

Printed by EBIS 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7112



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 5/27/2022  
A/C TSN 11354  
TACH 11354

#### Airframe Entries

Removed sticking roll trim cartridge and replaced with new (P/N 15660-001) Performed operational check of same, no defects noted

#### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE 5/27/2022

SIGNED

Darion McFadden A&P 4138120

Work Order: 7112

Printed by EBIS 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7027



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 2/18/2022  
A/C TSN 1038 2  
TACH 1038 2

**Airframe Entries**

Replaced failed pitot tube with new (P/N: 20919-001; S/N off: AS01199010, S/N on: AS10213704). Performed leak check and operational check of the same, no defects noted.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 2/18/2022

SIGNED

John Magnowski A&P 5273394

Work Order: 7027

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7028



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 2/21/2022  
A/C TSN 1045  
TACH 1045

**Airframe Entries**

Removed broken exhaust spring and replaced with new exhaust spring (P/N: 51381-001)

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 2/21/2022

SIGNED

Danon McFadden A&P 4138120

Work Order: 7028

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7056



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 3/18/2022  
A/C TSN 1076 6  
TACH 1076 6

**Airframe Entries**

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2022-06
- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due
- \*Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20
- \*Serviced brake fluid reservoir IAW Cirrus AMM 12-10
- \*Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.
- \*C/W ICA Concorde Sealed Battery, no defects noted
- \*C/W FAR 91 207 ELT Inspection, no defects noted. ELT Battery expiration date 05/2025.
- Removed worn LMLG and RMLG brake linings and replaced with new (P/N: 31392-105)
- Removed worn LMLG tire and replaced with new (P/N: 14075-010)
- Removed worn RMLG tire and replaced with new (P/N: 14075-010)
- Removed worn NLG tire and replaced with new (P/N: 12020-006) and serviced to proper inflation pressure.
- Removed both cracked NLG wheel pant brackets and replaced with new (P/N: 11799-004)
- Removed nose fork assembly, cleaned and re-installed with new grease and hardware. Set nose fork to proper tension per CAMM
- Removed stripped baggage floor panel nut-plate and replaced with new (P/N: MS21059L3)
- Removed worn cowl seal tape from bottom RH cowling and replaced with new (P/N: 53722-063U).

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE 3/18/2022

SIGNED

Mohammed Farhanuddin A&P 4183289

Work Order: 7056

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6975



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 11/23/2021  
A/C TSN 977 4  
TACH 977 4

**Airframe Entries**

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 11/23/2021 SIGNED: Work Order: 6975  
Sean McFadden IA 3647763 Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7012



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 1/26/2022  
A/C TSN 1022 1  
TACH 1022 1

**Airframe Entries**

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2022-02.
- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \*Performed airframe 50 hr inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20.
- \*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.
- Removed and replaced cracked induction plenum assembly (P/N: 31026-003).
- Removed chaffed alternator 2 field wire, and replaced with new (P/N: 50569-181). Performed operational check of same, no defects noted.
- Removed inoperative alternator #2 field control module from MCU and replaced with new (P/N: 29434-003; S/N off: 6896, S/N on: 7850). Performed operational check of same, no defects noted.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 1/26/2022 SIGNED: Work Order: 7012  
Mohammed Farhanuddin, A&P 4183289 Printed by EBis 3 (datcomedia.com)

ENGINE MODEL IO-390-C3B6  
ENGINE S/N L-838-80E  
REG NO N269JJ  
WORK ORDER 7018



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 2/8/2022  
A/C TSN 1027 9  
ENG TT 1027 9  
TACH 1027 9

**Engine Entries**

· Troubleshoot Tanis heater system not heating up, found probe #2 internally faulted and probe #4 shorted to the braided EGT harness. \*Replaced #2 and #4 probes with new (P/N: TTP2771-115/50) along with fuse (P/N: TU02848). Performed an operational check of the same, no defects noted.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 2/8/2022 SIGNED: Work Order: 7018  
John Magnowski A&P 3273394 Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7023



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 2/14/2022  
A/C TSN 1035 4  
TACH 1035 4

**Airframe Entries**

- Serviced NLG oleo strut with nitrogen and fluid to proper levels per CAMM, no defects noted.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 2/14/2022 SIGNED: Work Order: 7023  
Danon McFadden A&P 4138120 Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 6850



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 6/25/2021  
A/C TSN: 877.6  
TACH: 877.6

**Airframe Entries**

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 6/25/2021

SIGNED:

Work Order: 6850

Sean McFadden, IA: 3647763

Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG NO N269JJ  
WORK ORDER 6937



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 10/8/2021  
A/C TSN: 923.5  
TACH: 923.5

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2021-20  
\*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due  
\*Performed airframe 50 hr inspection IAW Cirrus AMM 5-20  
\*Serviced gascolator IAW Cirrus AMM 28-20  
\*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10  
C/W Cirrus SB2X-42-22R1, Perspective+ S/W Update v2647 N8, by updating and configuring new software. Performed operational check of same, no defects noted.  
Replaced broken pilot cup holder with new.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 10/8/2021

SIGNED:

Work Order: 6937

Danon McFadden A&P 4138120

Printed by EBis 3 (datcomedia.com)

**INSPECTION RECORD  
F.A.R. 43.11-91.409**

| DATE | AIRCRAFT TIME IN SERVICE | KIND OF INSPECTION-STATUS & DISCREPANCY LIST<br>SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE |
|------|--------------------------|--|
|------|--------------------------|--|

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG NO N269JJ  
WORK ORDER 6975



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 11/23/2021  
A/C TSN: 977.4  
TACH: 977.4

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2021-23.  
\*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due  
\*Performed airframe 100 hour inspection IAW Cirrus AMM 5-20  
\*Serviced gascolator IAW Cirrus AMM 28-20  
\*Serviced brake fluid reservoir IAW Cirrus AMM 12-10  
\*Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule  
C/W ICA Concorde Sealed Battery, no defects noted  
C/W FAR 91 207 ELT Inspection, no defects noted. ELT Battery expiration date 05/2025.  
C/W Cirrus SB2X-42-22R3, Perspective+ S/W Update v2647 N8, by updating marker beacon configuration during previous revision  
Replaced both #2 batteries (P/N 50979-001) with new. Performed an operational check of same, no defects noted.  
Removed worn LMLG and RMLG brake linings and replaced with new (P/N 31392-105).  
Removed worn rudder bellcrank rod end and replaced with new (P/N 11315-004), using new hardware.  
Replaced cracked exhaust muffler and replaced with new (P/N 21878-001).  
Removed broken left wingtip static wick and replaced with new (P/N 33266-001).  
Removed worn cowl seal tape from bottom right cowling and replaced with new (P/N: 53722-063U).

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 11/23/2021

SIGNED:

Work Order: 6975

John Magnowski A&P 3273394

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG. NO. N269JJ  
WORK ORDER: 6778



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 3/13/2021  
A/C TSN: 779.7  
TACH: 779.7

**Airframe Entries**

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 3/13/2021 SIGNED: Work Order: 6778  
Sean McFadden, IA: 3847763 Printed by EBis 3 (datcomedia.com)

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 6818



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 5/3/2021  
A/C TSN: 828.2  
TACH: 828.2

**Airframe Entries**

- \* Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2021-09.
- \* Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \* Performed airframe 50 hr inspection IAW Cirrus AMM 5-20.
- \* Serviced gascolator IAW Cirrus AMM 28-20.
- \* Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 5/3/2021 SIGNED: Work Order: 6818  
Mohammed Farhanuddin, A&P: 4183289 Printed by EBis 3 (datcomedia.com)

**INSPECTION RECORD  
F.A.R. 43.11-91.409**

| DATE | AIRCRAFT TIME IN SERVICE | SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE | KIND OF INSPECTION-STATUS & DISCREPANCY LIST |
|------|--------------------------|--|--|
|------|--------------------------|--|--|

MAKE: Cirrus Design Corp  
MODEL: Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 6850



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 6/25/2021  
A/C TSN: 877.6  
TACH: 877.6

**Airframe Entries**

- \* Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2021-12.
- \* Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \* Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.
- \* Serviced gascolator IAW Cirrus AMM 28-20.
- \* Serviced brake fluid reservoir IAW Cirrus AMM 12-10.
- \* Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.
- \* C/W ICA Concorde Sealed Battery, no defects noted.
- \* C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 05/2025.
- \* Removed worn LMLG and RMLG brake linings and replaced with new.
- \* Removed worn LMLG tire and replaced with new.
- \* Removed worn RMLG tire and replaced with new.
- \* Removed both worn MLG brake disc and replaced with new.
- \* Replaced worn clips on both MLG.
- \* Removed defective PFD and replaced with new (P/N: 010-N1308-30; S/N off: 494300946, S/N on: 494300802). Configured new PFD and performed operational check of same, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 6/25/2021 SIGNED: Work Order: 6850  
Mohammed Farhanuddin, A&P: 4183289 Printed by EBis 3 (datcomedia.com)

# INSPECTION RECORD

## F.A.R. 43.11-91.409

| DATE | AIRCRAFT TIME IN SERVICE | KIND OF INSPECTION-STATUS & DISCREPANCY LIST<br>SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE |
|------|--------------------------|--|
|      |                          |  |

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6745



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 1/29/2021  
A/C TSN 731 4  
TACH 731 4

### Airframe Entries

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2021-02.
- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \*Performed airframe 50 Hr. inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20.
- \*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.
- C/W SB2X-32-25, Oleo Strut Production Number Inspection, service bulletin does not apply by production number.
- C/W Cirrus SA19-13, Correction of SR2X Delivered Weight Data & Equipment Lists by correcting weight and balance records in POH.
- Removed leaking NLG oleo strut and replaced with new (Prod #: 0320-83).
- Troubleshoot pilot's report of fuel gauges inoperable on start-up. Could not duplicate discrepancy, no defects noted.
- Removed worn governor control cable bracket and bracket clip and replaced with new.
- Removed worn propeller governor control cable and replaced with new.
- Performed cosmetic re-seal of LH passenger window.

### Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 1/29/2021

SIGNED:

Danon McFadden, A&P 4138120

Work Order: 6745

Printed by EBis 3 (datcomedia.com)

# INSPECTION RECORD



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 3/13/2021  
A/C TSN 779 7  
TACH 779 7

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6778

### Airframe Entries

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2020-05.
- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \*Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20.
- \*Serviced brake fluid reservoir IAW Cirrus AMM 12-10.
- \*Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.
- \*C/W ICA Concorde Sealed Battery, no defects noted.
- \*C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 05/2025.
- C/W Cirrus SA19-18, Release of Hartzell Engine Technologies Alert Service Bulletin No. 081: Alternator Castellated Hex-Nut Inspection, Alternator does not apply by installation type.
- Cirrus SA20-19 does not apply by aircraft serial number.
- C/W Lycoming SB301b, 400 hour valve check, by inspection, no defects noted. Replaced all valve cover gaskets with new and torqued all valve cover screws.
- Removed failed capacitance test main battery and replaced with new (P/N: RG24-11M, S/N off: 41008074, S/N on: 41139947). Performed an operational check of the same, no defects noted.
- Removed worn LMLG and RMLG brake linings and replaced with new.
- Removed worn LMLG tire and replaced with new.
- Removed LMLG wheel clips worn beyond limits, and replaced with new hardware.
- Removed worn RMLG tire and replaced with new.
- Removed RMLG wheel clips worn beyond limits, and replaced with new hardware.
- Installed new washers to bring the MLG strut grommet gap to within limits.
- Removed out of round nose wheel air valve and replaced with new.
- Removed nose fork assembly, cleaned and re-installed with new grease and hardware. Set nose fork to proper tension per CAMM.
- Removed cracked left side aft baffle and replaced with new.
- Removed corroded rod ends from inboard attaching rod on LH flap and replaced with new.
- Repaired broken LH passenger side cup holder. Performed operational check of same, no defects noted.
- Repaired pilot side cup holder. Performed operational check of same, no defects noted.
- Removed damaged LH elevator static wick and replaced with new.
- Removed damaged outboard static wick from RH wing and replaced with new.

### Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 3/13/2021

SIGNED:

Mohammed Farhanuddin A&P 4183289

Work Order: 6778

Printed by EBis 3 (datcomedia.com)



MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6659



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 8/30/2020  
A/C TSN 568 4  
TACH 5C8 4

**Airframe Entries**

Inspected aircraft for report of "bird strike to windshield on take off". Removed bird residue from engine cowling, windshield, and vertical stabilizer. Inspected aircraft per Cirrus SR20 AMM 5-50 (2.b) Bird Strike Inspection, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 8/30/2020 SIGNED: Work Order: 6659  
Sean McFadden, A&P 3647763 Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6668



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 9/15/2020  
A/C TSN 540  
TACH 540

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2020-19.  
Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.  
Performed airframe 50 Hr. inspection IAW Cirrus AMM 5-20.  
Serviced gascolator IAW Cirrus AMM 28-20.  
Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.  
Removed worn LMLG tire and replaced with new.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 9/15/2020 SIGNED: Work Order: 6668  
Danon McFadden, A&P 4138120 Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6689



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 10/22/2020  
A/C TSN 589 7  
TACH 589 7

**Airframe Entries**

Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2020-21.  
Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.  
Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.  
Serviced gascolator IAW Cirrus AMM 28-20  
Serviced brake fluid reservoir IAW Cirrus AMM 12-10  
Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule  
C/W ICA Concorde Sealed Battery, no defects noted  
C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 5/2025.  
Removed worn LMLG and RMLG brake linings and replaced with new.  
Removed worn LMLG tire and replaced with new  
Troubleshoot "water noted in fuel sump drain on right wing after rain", found  
Removed broken clamp and replaces with new

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 10/22/2020 SIGNED: Work Order: 6689  
Mohammed Farhanuddin, A&P 4183289 Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6689



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 10/22/2020  
A/C TSN 589 7  
TACH 589 7

**Airframe Entries**

I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE 10/22/2020 SIGNED: Work Order: 6689  
Sean McFadden, A&P 3647763 Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6638



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 7/31/2020  
A/C TSN 449 8  
TACH 449 8

**Airframe Entries**

- Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2020-15.
- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.
- \*Performed airframe 50 Hr. inspection IAW Cirrus AMM 5-20.
- \*Serviced gascolator IAW Cirrus AMM 28-20.
- \*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10.
- C/W Cirrus SB2X-76-04, Power Control - Hard Contact Between Elevator and Throttle Cables, by installation of adel clamps.
- Repaired pilot side cup holder assembly.
- Tightened pilot's headphone jack, no defects noted.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 7/31/2020

SIGNED:

Work Order: 6638

Danon McFadden, A&P 4138120

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6649



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 8/21/2020  
A/C TSN 489 2  
TACH 489 2

**Airframe Entries**

· I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 8/21/2020

SIGNED:

Work Order: 6649

Sean McFadden, IA 3647763

Printed by EBis 3 (datcomedia.com)

**INSPECTION RECORD  
F.A.R. 43.11-91.409**

| DATE | AIRCRAFT TIME IN SERVICE | KIND OF INSPECTION-STATUS & DISCREPANCY LIST<br>SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE   |   |
|------|--------------------------|--|---|
|      |                          | <b>Nassau Flyers</b><br>1300 New Hwy<br>Farmingdale, NY 11735<br>Phone 631-454-0626  | DATE 8/21/2020<br>A/C TSN 489 2<br>TACH 489 2 |
|      |                          | <b>Airframe Entries</b> <ul style="list-style-type: none"> <li>· Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2020-17.</li> <li>· *Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.</li> <li>· *Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.</li> <li>· *Serviced gascolator IAW Cirrus AMM 28-20.</li> <li>· *Serviced brake fluid reservoir IAW Cirrus AMM 12-10.</li> <li>· *Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.</li> <li>· C/W ICA Concorde Sealed Battery, no defects noted.</li> <li>· C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 5/2025.</li> <li>· Replaced both #2 batteries (P/N: 50979-001) with new. Performed an operational check of same, no defects noted.</li> <li>· Removed worn LMLG tire and replaced with new.</li> <li>· Removed worn RMLG tire and replaced with new.</li> <li>· Removed worn LMLG and RMLG brake linings and replaced with new.</li> <li>· Removed worn NLG tire and replaced with new. Serviced tire to proper inflation pressure.</li> <li>· Removed corroded NLG wheel bearings and replaced with new.</li> <li>· Removed fraying bonding strap from upper LH engine mount and replaced with new.</li> <li>· Removed damaged nose fork assembly, and replaced with new.</li> <li>· Installed new baggage door chafe plate wellnuts where previously missing.</li> </ul> |   |
|      |                          | <b>Maintenance Release</b><br>This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times   |   |
|      |                          | DATE: 8/21/2020  | SIGNED:                                       |
|      |                          | Work Order: 6649<br>Danon McFadden A&P 4138120   |   |
|      |                          | Printed by EBis 3 (datcomedia.com)   |   |

MAKE Cirrus Design Corp  
 MODEL Sr20  
 S/N 2487  
 REG NO N269JJ  
 WORK ORDER 6594



**Nassau Flyers**  
 1300 New Hwy  
 Farmingdale, NY 11735  
 Phone 631-454-0626

DATE 5/28/2020  
 A/C TSN 345 4  
 TACH 345 4

**Airframe Entries**

- Researched Airworthiness Directives through current bi-weekly 2020-11
- \*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins due
- \*Performed airframe 50 Hr inspection IAW Cirrus AMM 5-20
- \*Serviced gascolator IAW Cirrus AMM 28-20
- \*Serviced all tires to proper inflation pressures IAW Cirrus AMM 12-10

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 5/28/2020 SIGNED: Work Order 6594  
 Sean McFadden, A&P 3647763 Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
 MODEL Sr20  
 S/N 2487  
 REG NO N269JJ  
 WORK ORDER 6606



**Nassau Flyers**  
 1300 New Hwy  
 Farmingdale, NY 11735  
 Phone 631-454-0626

DATE 6/25/2020  
 A/C TSN 395 1  
 TACH 395 1

**Airframe Entries**

· I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 6/25/2020 SIGNED: Work Order: 6606  
 Sean McFadden, IA 3647763 Printed by EBis 3 (datcomedia.com)

**INSPECTION RECORD  
 F.A.R. 43.11-91.409**

| DATE | AIRCRAFT TIME IN SERVICE  | SIGNATURE —   | KIND OF INSPECTION—STATUS & DISCREPANCY LIST<br><small>CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE</small>  |
|------|---|---|--|
|      |   |   |  |
|      | MAKE Cirrus Design Corp<br>MODEL Sr20<br>S/N 2487<br>REG NO N269JJ<br>WORK ORDER 6606 | <b>Nassau Flyers</b><br>1300 New Hwy<br>Farmingdale, NY 11735<br>Phone 631-454-0626 | DATE 6/25/2020<br>A/C TSN 395 1<br>TACH 395 1  |
|      | <b>Airframe Entries</b>   |   | <ul style="list-style-type: none"> <li>· Researched aircraft records for applicable Airworthiness Directives through current bi-weekly 2020-13.</li> <li>*Researched aircraft records for applicable Cirrus Mandatory Service Bulletins that are due.</li> <li>*Performed airframe 100 hour inspection IAW Cirrus AMM 5-20.</li> <li>*Serviced gascolator IAW Cirrus AMM 28-20.</li> <li>*Serviced brake fluid reservoir IAW Cirrus AMM 12-10.</li> <li>*Lubricated aircraft IAW Cirrus AMM 12-20 lubrication schedule.</li> <li>*C/W ICA Concorde Sealed Battery, no defects noted.</li> <li>*C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 5/2025.</li> <li>· Removed worn LMLG and RMLG brake linings and replaced with new.</li> <li>· Removed worn LMLG tire and replaced with new.</li> <li>· Removed worn RMLG tire and replaced with new.</li> <li>· Removed both cracked NLG wheel pant brackets and replaced with new.</li> <li>· Replaced broken RH passenger cup holder with new.</li> <li>· Replaced damaged tach sensor (P/N: 38457-001) with new. Performed an operational check of same, no defects noted.</li> </ul> |
|      |   |   | <b>Maintenance Release</b>   |
|      |   |   | This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.   |
|      |   | DATE: 6/25/2020 SIGNED:   | Work Order: 6606   |
|      |   | Daron McFadden, A&P 4138120   | Printed by EBis 3 (datcomedia.com)   |



MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6388



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 9/4/2019  
A/C TSN 153 3  
TACH 153 3

# INSPECTION RECORD F.A.R. 43.11-91.409

### Airframe Entries

- Performed a 50 hour inspection of airframe per Cirrus AMM and Cirrus inspection checklists, Chaps 05-02 and 05-30.
- \*Serviced airframe interior and exterior including lights, batteries, struts, tires brakes, fluids and screens.
- Removed worn LMLG and RMLG brake linings and replaced with new.

### Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 9/4/2019

SIGNED:

Roberto Ruiz A&P 3233677

Work Order: 6388

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6426



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 11/12/2019  
A/C TSN 197  
TACH 197

### Airframe Entries

- I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

### Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 11/12/2019

SIGNED:

Sean McFadden IA 3647763

Work Order: 6426

Printed by EBis 3 (datcomedia.com)

| DATE | AIRCRAFT TIME IN SERVICE | KIND OF INSPECTION-STATUS & DISCREPANCY LIST<br>SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE  |
|------|--------------------------|---|
|      |                          | <p>MAKE Cirrus Design Corp<br/>MODEL Sr20<br/>S/N 2487<br/>REG NO N269JJ<br/>WORK ORDER 6426</p> <p><b>NASSAU FLYERS X</b></p> <p><b>Nassau Flyers</b><br/>1300 New Hwy<br/>Farmingdale, NY 11735<br/>Phone 631-454-0626</p> <p>DATE 11/12/2019<br/>A/C TSN 197<br/>TACH 197</p> <p><b>Airframe Entries</b></p> <ul style="list-style-type: none"> <li>Performed a 100 hour inspection of airframe per Cirrus AMM and Cirrus inspection checklists, Chaps 05-02 and 05-30.</li> <li>*Serviced airframe interior and exterior including lights, batteries, struts, tires brakes, fluids and screens.</li> <li>*C/W ICA Concorde Sealed Battery, no defects noted</li> <li>*C/W FAR 91 207 ELT Inspection, no defects noted ELT Battery expiration date 5/2025</li> <li>C/W 200 hour interval items per Cirrus AMM and Cirrus inspection checklists</li> <li>Removed/serviced/inspected/reinstalled both #2 batteries and performed an operational check of same, no defects noted.</li> <li>C/W Beringer SB-015 by inspection, and replaced LMLG wheel assembly</li> <li>C/W AVStar AFS-SIL-01 by inspection, no defects noted</li> <li>Removed worn LMLG and RMLG brake linings and replaced with new</li> <li>Removed worn RMLG tire and replaced with new</li> <li>Removed LMLG tire and rotated on wheel assembly to promote even wear. Serviced same wheel bearings</li> <li>Found inner weight detached from NLG tire. Removed inner weight, balanced, and re-installed NLG tire and wheel.</li> <li>Removed nose fork assembly, cleaned and re-installed with new grease and hardware</li> <li>Removed right door seal, cleaned area, and replaced with new</li> <li>Removed cracked induction plenum and replaced with new</li> </ul> <p><b>Maintenance Release</b></p> <p>This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.</p> <p>DATE 11/12/2019</p> <p>SIGNED: </p> <p>Jasmit Singh A&amp;P 4099112</p> <p>Work Order: 6426</p> <p>Printed by EBis 3 (datcomedia.com)</p> |

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6305

**INSPECTION RECORD**

**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 6/6/2019  
A/C TSN 26  
TACH 26

**Airframe Entries**

- Performed a 25 hour inspection of airframe per Cirrus AMM and Cirrus inspection checklists, Chaps 05-02 and 05-30.
- \*Serviced airframe interior and exterior including lights, batteries, struts, tires brakes, fluids and screens.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 6/6/2019

SIGNED: 

Jasmit Singh A&P 4099112

Work Order: 6305

Printed by EBis 3 (dalcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6336



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 7/1/2019  
A/C TSN 507  
TACH 507

**Airframe Entries**

- Performed a 50 hour inspection of airframe per Cirrus AMM and Cirrus inspection checklists, Chaps 05-02 and 05-30.
- \*Serviced airframe interior and exterior including lights, batteries, struts, tires brakes, fluids and screens.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 7/1/2019

SIGNED: 

Jasmit Singh A&P 4099112

Work Order: 6336

Printed by EBis 3 (dalcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6353



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 8/1/2019  
A/C TSN 986  
TACH 986

**Airframe Entries**

- Performed a 100 hour inspection of airframe per Cirrus AMM and Cirrus inspection checklists, Chaps 05-02 and 05-30.
- \*Serviced airframe interior and exterior including lights, batteries, struts, tires brakes, fluids and screens.
- \*C/W ICA Concorde Sealed Battery, no defects noted.
- \*C/W FAR 91.207 ELT Inspection, no defects noted. ELT Battery expiration date 5/2025.
- Removed worn LMLG tire and replaced with new.
- Rotated RMLG tire on wheel assembly to promote even wear. Serviced same wheel bearings.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 8/1/2019

SIGNED: 

Jasmit Singh A&P 4099112

Work Order: 6353

Printed by EBis 3 (dalcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6353



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 8/1/2019  
A/C TSN 986  
TACH 986

**Airframe Entries**

- I certify that this Aircraft (including airframe, engine, propeller and appliance) has been inspected in accordance with an Annual inspection as outlined in FAR 43 Appendix D, and was determined to be in an airworthy condition. AD's checked through this date, c/w all AD's due this inspection.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 8/1/2019

SIGNED: 



Sean McFadden IA 3647763

Work Order: 6353

Printed by EBis 3 (dalcomedia.com)

# INSPECTION RECORD

## F.A.R. 43.11-91.409
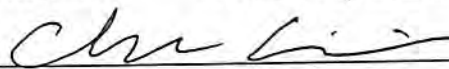
| DATE      | AIRCRAFT TIME IN SERVICE | KIND OF INSPECTION-STATUS & DISCREPANCY LIST<br>SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE  |
|-----------|--------------------------|---|
| 18 Apr 19 | 0.8                      | <p>Production Flight Test accomplished in accordance with Cirrus Procedure #90500.</p> <p>Name: Chad Friedrich      Date <u>18 Apr 19</u></p> <p>Signature: <u></u></p> <p>Title: Production Flight Test Pilot</p>  |
| 8/Am/2019 | 0.8                      | <p>I find that the aircraft meets the requirements for the certification requested and have issued an U.S. Standard Airworthiness Certificate dated <u>18 APR 2019</u>.</p> <p>The next inspection is due <u>30 APR 2020</u>.</p> <p><u></u></p> <p>Aaron S. Knudsen<br/>293766879</p> |

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N259JJ  
WORK ORDER 7229



Nassau Flyers  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 9/26/2022  
A/C TSN 1259  
TACH 1259

### Airframe Entries

Dressed nicks on propeller as required per CAMM 5-20.

### Maintenance Release

This aircraft engine propeller or component(s) on N259JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 9/26/2022

SIGNED

John Magnovsky A&P 3273394

Work Order 7229

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 7259



Nassau Flyers  
1300 New Hwy  
Farmingdale NY 11735  
Phone 631-454-0626

DATE 10/28/2022  
A/C TSN 1277 5  
TACH 1277 5

### Airframe Entries

Removed worn LMLG tire and replaced with new (P/N: 14075-010) and serviced to proper inflation pressure.  
Removed worn RMLG tire and replaced with new (P/N: 14075-010) and serviced to proper inflation pressure.

### Maintenance Release

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 10/28/2022

SIGNED

Daron McFadden A&P 4138120

Work Order: 7259

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6920



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 9/13/2021  
A/C TSN 900 6  
TACH 900 6

**Airframe Entries**

Removed defective PFD (P/N: 011-03470-30; S/N off: 494300802, S/N on: 494300856) and replaced with new. Performed configuration and operational check of same, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 9/13/2021

SIGNED:

Danon McFadden, A&P 4138120

Work Order: 6920

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6883



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 9/22/2021  
A/C TSN 900 6  
TACH 900 6

**Airframe Entries**

- Removed deteriorating window seal from left door window, cleaned area, and replaced with new.
- Removed deteriorating window seal from aft right window, cleaned area, and replaced with new.
- Troubleshoot pilot's report of dual alternator failure, found both field control modules defective. Removed and replaced alternator #2 worn attach hardware with new.
- Removed GMU1 Magnetometer in serviceable condition for use on another aircraft, then installed new GMU1 Magnetometer (P/N 011-00870-10; S/N off: 1CM027950, S/N on: 1CM011668).
- Removed GMU2 Magnetometer in serviceable condition for use on another aircraft, then installed new GMU2 Magnetometer (P/N 011-00870-10; S/N off: 1CM027990, S/N on: 1CM037215) with new. Configured both magnetometers and performed operational check of same. No defects noted.
- Replaced defective MCU with new (P/N: 19800-004; S/N off: 05686, S/N on: 06193).
- Removed broken alternator #2 power cable and replaced with new.
- Removed shorted alternator #2 field control module (P/N: 29434-003, S/N off: 11805, S/N on: 6896) from MCU and replaced with new. Performed operational check of same, no defects noted.
- Performed engine run-up and MCU operational inspection, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 9/22/2021

SIGNED:

Danon McFadden, A&P 4138120

Work Order: 6883

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6953



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 10/28/2021  
A/C TSN 947 1  
TACH 947 1

**Airframe Entries**

Troubleshoot pilot's report of alternator #2 failure, found field wire broken at terminal. Repaired broken field wire and performed operational check. No defects noted.  
Troubleshoot "Failed Path CAS message, AFCS Inop, Pitch and Roll Servo Comm" by disconnecting, cleaned, inspecting, and re-connecting cannon plugs on the roll servo and the pitch servo. Performed operational check of same, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 10/28/2021

SIGNED:

Danon McFadden, A&P 4138120

Work Order 6953

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6990



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 12/15/2021  
A/C TSN 1000 2  
TACH 1000 2

**Airframe Entries**

Removed worn LMLG tire and replaced with new.  
Removed worn RMLG tire and replaced with new.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 12/15/2021

SIGNED:

John Matynowski, A&P 3273394

Work Order 6990

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6600



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 6/10/2020  
A/C TSN 384 6  
TACH 384 6

**Airframe Entries**

- Removed alternator #2 (P/N 31090-001; S/N off: H-T031583, S/N on: H-T103381) and replaced with new Replaced MCU-140 P/N 19800-003 S/N 05067 with new P/N 19800-004 S/N 05686
- \*Performed an operational check of electrical system and alternator 2 circuit, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 6/10/2020

SIGNED:

Darion McFadden, A&P 4138120

Work Order: 6600

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6707



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE 11/23/2020  
A/C TSN 681 6  
TACH 681 6

**Airframe Entries**

- Removed worn LMLG tire and replaced with new.
- Troubleshoot pilot's report of oil in bottom LH engine cowling, found oil breather hose disconnected from manifold drain. Re-connected hose to drain, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 11/23/2020

SIGNED:

Darion McFadden, A&P 4138120

Work Order: 6707

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6737



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 1/8/2021  
A/C TSN 711 8  
TACH 711 8

**Airframe Entries**

- C/W Cirrus SB2X-53-10, Alternate Cabin Door Seal Installation, by installation of new door seal. No defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 1/8/2021

SIGNED:

Mohammed Farhanuddin, A&P 4183289

Work Order: 6737

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 6808



**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 4/13/2021  
A/C TSN: 810.4  
TACH: 810.4

**Airframe Entries**

- Removed worn LMLG tire and replaced with new.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 4/13/2021

SIGNED:

Darion McFadden, A&P: 4138120

Work Order: 6808

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6454

**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 11/29/2019  
A/C TSN 216 3  
TACH 216 3

**Airframe Entries**

Removed loaner RH wing tip installed original RH wing tip after repairs. Performed an operational check of all lighting. no defects noted

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE 11/29/2019

SIGNED

Jasmit Singh A&P 4059112

Work Order 6454

Printed by EBis 3 (datcomedia.com)



MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6506



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 1/23/2020  
A/C TSN 245 5  
TACH 245 5

**Airframe Entries**

- Removed worn LMLG tire and replaced with new.
- Troubleshoot Pilot report "Hobbs counter stopped counting at 299.9" and found Hobbs meter not keeping time accurately.
- Removed inoperable hobbs meter and replaced with new. Installed new hobbs meter at 0.1 hours. Performed an operational check of the same, no further defects noted.

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE: 1/23/2020

SIGNED:

Jasmit Singh A&P 4059112

Work Order: 6506

Printed by EBis 3 (datcomedia.com)



MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6470



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 12/16/2019  
A/C TSN 216 3  
TACH 216 3

**Airframe Entries**

Serviced NLG oleo strut with nitrogen and fluid to proper levels per CMM. no defects noted

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times

DATE 12/16/2019

SIGNED

Jasmit Singh A&P 4059112

Work Order 6470

Printed by EBis 3 (datcomedia.com)



MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6552



**Nassau Flyers**

1300 New Hwy  
Farmingdale, NY 11735  
Phone 631-454-0626

DATE 3/6/2020  
A/C TSN 280 2  
TACH 280 2

**Airframe Entries**

- Troubleshoot "Pilot side upper door latch does not lock closed", found upper door latch gearbox control rod bent.
- Replaced bent pilot's upper door latch gear box with new and performed an operational check of the same, no defects noted.

Maintenance Release

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times


DATE: 3/6/2020

SIGNED:

Sean McFadden A&P 3647763

Work Order: 6552

Printed by EBis 3 (datcomedia.com)



MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6403

**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone: 631-454-0626

DATE 9/25/2019  
A/C TSN 180.5  
TACH 180.5

**Airframe Entries**

· Serviced NLG oleo strut with nitrogen and fluid to proper levels per CAMM, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 9/25/2019

SIGNED: 

Jasmit Singh, A&P: 4099112

Work Order: 6403

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N 2487  
REG NO N269JJ  
WORK ORDER 6414



**Nassau Flyers**  
1300 New Hwy  
Farmingdale NY 11735  
Phone: 631-454-0626

DATE 10/25/2019  
A/C TSN 193.6  
TACH 193.6

**Airframe Entries**

Re-installed same Hartzell propeller assembly (P/N HC-E3YR-1RF, S/N FM2272B) on aircraft after repairs by Sensenich Propellers PA. Performed an operational and leak check of the same, no defects noted.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE 10/25/2019

SIGNED: 

Darion McFadden, A&P: 4138120

Work Order: 6414

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
MODEL Sr20  
S/N: 2487  
REG. NO: N269JJ  
WORK ORDER: 6414

**Nassau Flyers**  
1300 New Hwy  
Farmingdale, NY 11735  
Phone: 631-454-0626

DATE: 10/11/2019  
A/C TSN: 193.6  
TACH: 193.6

**Airframe Entries**

· Removed Hartzell propeller assembly (P/N: HC-E3YR-1RF, S/N: FM2272B) from aircraft for repair.

**Maintenance Release**

This aircraft, engine, propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft, engine, propeller or component(s) is approved for return to service regarding the work performed and described above, this date and times.

DATE: 10/11/2019

SIGNED: 

Roberto Ruiz, A&P: 3233677

Work Order: 6414

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus  
MODEL SR20 G6  
S/N 2487  
REG NO N269JJ  
WORK ORDER  
6823-10-2019

**ADVANCED Fly Advanced**

Repair Station No 5T2R901C  
530 Airport Rd  
Lititz, PA 17543  
Phone: 717-735-5179

DATE: 10/15/2019  
A/C TSN 193.6  
HOBBS 281.1

**Airframe Entries**

Completed a small composite repair to the right wing tip assembly. Filled, sanded, primed and painted the wing tip to match. Re-sealed the recognition light lens as required.

**Maintenance Release**

The aircraft and/or component(s) on N269JJ was repaired and inspected in accordance with the current rules and regulations of Title 14 of the Code of Federal Regulations. was found Airworthy and was returned to service.

DATE 10/15/2019

SIGNED: 

Joshua J. Ferry  
Certified Repair Station No. 5T2R901C

Work Order 6823-10-2019

Printed by EBis 3 (datcomedia.com)

**MAINTENANCE RECORD**

MAKE Cirrus Design Corp  
 MODEL Sr20  
 S/N 2487  
 REG NO N269JJ  
 WORK ORDER 6293

**Nassau Flyers**

1300 New Hwy  
 Farmingdale NY 11735  
 Phone 631-454-0626

DATE 5/29/2019  
 A/C TSN 15  
 TACH 15

**Airframe Entries**


· Troubleshoot "standby IAS inoperative", found standby airspeed indicator inoperative, no movement on gauge with actual airspeed. Replaced airspeed indicator with new (P/N: 13562-007; S/N off: T59454, S/N on: T59217). Performed an operational check of the same, no defects noted.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 5/29/2019

SIGNED:

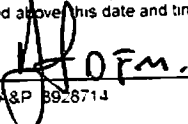

Diego Melo A&amp;P 392671J

Work Order: 6293

Printed by EBis 3 (datcomedia.com)

MAKE Cirrus Design Corp  
 MODEL Sr20  
 S/N 2487  
 REG NO N269JJ  
 WORK ORDER 6403

**Nassau Flyers**

1300 New Hwy  
 Farmingdale NY 11735  
 Phone 631-454-0626

DATE 9/25/2019  
 A/C TSN 180 5  
 TACH 180 5

**Airframe Entries**


· Removed damaged right wing tip. Prepped, painted, installed new wing tip on right wing.

**Maintenance Release**

This aircraft engine propeller or component(s) on N269JJ were repaired and inspected in accordance with current Federal Aviation Regulations and manufacturers recommendations and was found to be in airworthy condition. This aircraft engine propeller or component(s) is approved for return to service regarding the work performed and described above this date and times

DATE: 9/25/2019

SIGNED:

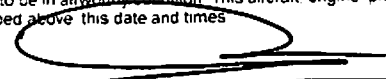

Sean McFadden A&amp;P 3647763

Work Order: 6403

Printed by EBis 3 (datcomedia.com)









# AIRCRAFT DESCRIPTION

MANUFACTURER Cirrus Design Corp. MODEL SR20 DATE OF MFG. Apr 2019

SERIAL NUMBER 2487 REGISTRATION NUMBER N269JJ

REGISTERED OWNER \_\_\_\_\_  
STREET ADDRESS \_\_\_\_\_  
CITY, STATE, ZIP \_\_\_\_\_

OPERATOR \_\_\_\_\_  
STREET ADDRESS \_\_\_\_\_  
CITY, STATE, ZIP \_\_\_\_\_

REGISTERED OWNER \_\_\_\_\_  
STREET ADDRESS \_\_\_\_\_  
CITY, STATE, ZIP \_\_\_\_\_

OPERATOR \_\_\_\_\_  
STREET ADDRESS \_\_\_\_\_  
CITY, STATE, ZIP \_\_\_\_\_

## Inspection Status (Check one)

F.A.R. 91.409 ANNUAL/100 HOUR

F.A.R. 91.409 PROGRESSIVE

F.A.R. 135.419 A.T.C.O.

OTHER

DATE ENTERED \_\_\_\_\_

MAINTENANCE RESPONSIBILITY \_\_\_\_\_