

Wheel History



P/N 3-1621

S/N 3831

This set of wheels and tires was moved from spare status and installed on aircraft in July/2023. When these wheels were reinstalled on the aircraft on 8-2-2023 (MTR Date) they had 1 tire change, ~~1 overhaul~~ and 186 landings.

Wheel 3256 / Tire 1214K111

Wheel 3261 / Tire 1214K102

Wheel 3262 / Tire 1211K101

Wheel 3831 / Tire 1212K109



TEXTRON AVIATION

Maintenance Transaction Record

This Maintenance Report is To Be Used Solely For:

MTR ID # 8188154 Replaces MTR ID # 8188146
Page 8 of 11

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

✓ Airframe Entries

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	02-Aug-23	KSAT	2003.9	1530	2003.9	2003.9	1530	1530			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
324009	41	1	MAIN LANDING GEAR WHEEL	RIGHT OUTBOARD	3-1621		3262	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM R/H OUTBOARD MAIN WHEEL ITR GOODRICH 32-45-53 INSTALLED CUSTOMER SUPPLIED RH OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3262 WITH TIRE PN: M14401 SN: 1211K101 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324009	42	1	MAIN LANDING GEAR WHEEL	RIGHT INBOARD	2-1621		3831	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM R/H INBOARD WHEEL ITR GOODRICH M/M32-45-53. INSTALLED CUSTOMER SUPPLIED RH INBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3831 WITH TIRE PN: M14401 SN: 1212K109 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324010	43	1	MAIN LANDING GEAR TIRE	LEFT INBOARD	M14401		1214K111	UN	N	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H INBOARD WHEEL ITR GOODRICH M/M 32-45-53. INSTALLED CUSTOMER SUPPLIED LEFT INBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3256 WITH TIRE PN: M14401 SN: 1214K111 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324210	44	1	MAIN LANDING GEAR TIRE	LEFT OUTBOARD	M14401		1214K102	UN	N	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H OUTBOARD WHEEL ITR GOODRICH M/M 32-45-53 INSTALLED CUSTOMER SUPPLIED LEFT OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3261 WITH TIRE PN: M14401 SN: 1214K102 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324010	45	1	MAIN LANDING GEAR TIRE	RIGHT OUTBOARD	M14401		1211K101	UN	N	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM R/H OUTBOARD MAIN WHEEL ITR GOODRICH 32-45-53 INSTALLED CUSTOMER SUPPLIED RH OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3262 WITH TIRE PN: M14401 SN: 1211K101 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, 5-Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility	Textron Aviation Service - SAT	Certified Repair Station Number	CNQ5918C	Work Order #	191294
Work Performed By	Textron Aviation Service - SAT	Certificate No.	CNQ5918C	Date	02-Aug-23
I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the					
✓ Federal Aviation Administration		Other (specify) _____			
I CERTIFY THAT THE ABOVE MAINTENANCE & INFORMATION CONTAINED IN THE LISTED WORK ORDER WAS PERFORMED IN ACCORDANCE WITH THE CURRENT FAA REGULATIONS & THE AIRCRAFT/COMPONENT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY & APPROVED FOR RETURN TO SERVICE					
Work Inspected By	Eric Cortinas	Certificate No.	CNQ5918C	Date	02-Aug-23
ELECTRONICALLY SIGNED ON 02-AUG-23					
Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3	8

This set of wheels and tires was due a tire change. As a precaution against corrosion the wheels were overhauled by TEXTRON/Orlando with new tires and were then put into spare status.

Removed	Installed
Wheel 3256 / Tire 8317J105	1214K111
Wheel 3261 / Tire 8317J112	1214K102
Wheel 3262 / Tire 9059J118	1211K101
Wheel 3831 / Tire 9062J125	1212K109

This set of wheels and tires was purchased in December of 2019 to replace our other set of main wheels that were condemned for corrosion when we went into maintenance for a tire change.

Wheel 3256 / Tire 8317J105

Wheel 3261 / Tire 8317J112

Wheel 3262 / Tire 9059J118

Wheel 3831 / Tire 9062J125

Beechcraft



Textron

TEXTRON AVIATION

TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8020153

Page 2 of 3

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	13-Dec-19	KMCO	1366.3	1106	1106.0	1106.0	1052	1052			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/ Item	Transaction No. Type	Item Name	Position	Part Number/ Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
32-41-00-2200	8 2	LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	LEFT OUTBOARD						
Comment: Complied with LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW task 32-41-00-2200									
32-41-00-2200	9 2	RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT INBOARD						
Comment: Complied with RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW task 32-41-00-2200									
32-41-00-2200	10 2	RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT OUTBOARD						
Comment: Complied with RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW task 32-41-00-2200									
32-41-00-2801	11 2	RIGHT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	RIGHT OUTBOARD	6941060-1		3256			
Comment: Complied with RIGHT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.									
32-41-00-2801	12 2	LEFT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	LEFT INBOARD	6941060-1		3262			
Comment: Complied with LEFT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.									
32-41-00-2801	13 2	RIGHT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	RIGHT INBOARD	6941060-1		3831			
Comment: Complied with RIGHT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.									

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected

Repair Facility Textron Aviation Service - MCOCertified Repair Station Number CNQ8918CWork Order # 122691Work Performed By Textron Aviation Service - MCOCertificate No. CNQ8918CDate 13-Dec-19

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

✓ Federal Aviation Administration

Other (specify) _____

ALL MAINTENANCE WAS PERFORMED IN ACCORDANCE WITH APPROVED/CURRENT TECHNICAL DATA.

Work Inspected By Hans FurberCertificate No. CNQ8918CDate 13-Dec-19

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log

Section	Page
3	2

Beechcraft



Textron

TEXTRON AVIATION

TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8020153

Page 3 of 3

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

V/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	13-Dec-19	KMCO	1366.3	1106	1106.0	1106.0	1052	1052			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/ Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
324009	14	1	MAIN LANDING GEAR TIRE	LEFT OUTBOARD	M14401		8317J112	WO	N	
Comment: Removed PN: M14401 SN: 7231J123 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
324009	15	1	MAIN LANDING GEAR TIRE	LEFT INBOARD	M14401		9059J118	WO	N	
Comment: Removed PN: M14401 SN: 7232J115 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
324009	16	1	MAIN LANDING GEAR TIRE	RIGHT INBOARD	M14401		9062J125	WO	N	
Comment: Removed PN: M14401 SN: 7239J118 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
324009	17	1	MAIN LANDING GEAR TIRE	RIGHT OUTBOARD	M14401		8317J105	WO	N	
Comment: Removed PN: M14401 SN: 7232J116 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
32-41-00-2801	18	2	LEFT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	LEFT OUTBOARD	6941060-1		3261			
Comment: Complied with LEFT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other(note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility Textron Aviation Service - MCOCertified Repair Station Number CNQ8918CWork Order # 122691Work Performed By Textron Aviation Service - MCOCertificate No. CNQ8918CDate 13-Dec-19

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

✓ Federal Aviation Administration

Other (specify) _____

ALL MAINTENANCE WAS PERFORMED IN ACCORDANCE WITH APPROVED/CURRENT TECHNICAL DATA.

Work Inspected By Hans FurberCertificate No. CNQ8918CDate 13-Dec-19

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log

Section	Page
3	3

Wheel History



P/N 3-1538-1

S/N 1700



TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

☒ Airframe Entries

MTR ID # 8181967

Page 1 of 1

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	12-Jun-23	KBED	1972.0	1516							

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
1	1			RH Nose	M15601		1345T179	WO	N	
Comment: Installed new RH Nose wheel/tire IAW BF Goodrich CMM. 3-1538 REV.3 CH 32-47-43. Installed RH tire wheel assy IAW Model 680 MM CH. 32-41-10. P/N OFF: M15601 S/N OFF: 1039T185.										
2	1			LH Nose	M15601		2307T159	WO	N	
Comment: Installed new LH nose wheel/tire IAW BF Goodrich CMM 3-1538 REV. 3 CH. 32-47-43. Installed LH nose wheel/tire assy IAW Model 680 MM CH. 32-41-10. P/N OFF: M15601 S/N OFF: 1040T150										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other(note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility	<u>NYCSC</u>	Certified Repair Station Number	<u>CNQ6918C</u>	Work Order #	<u>193961</u>
Work Performed By	<u>Dan Whitehead</u>	Certificate No.	<u>CNQ6918C</u>	Date	<u>12-Jun-23</u>
I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the					
☒ Federal Aviation Administration		Other (specify) _____			
and the aircraft/component identified above is presently airworthy & approved for return to service.					
Work Inspected By	<u>Dan Whitehead</u>	Certificate No.	<u>CNQ6918C</u>	Date	<u>12-Jun-23</u>
ELECTRONICALLY SIGNED ON 12-JUN-23					
Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3	



TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

MTR ID # 8100654 Replaces MTR ID # 8098043

Page 5 of 6

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

✓ Airframe Entries

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	12-Aug-21	KMCO	1590.4	1273	1590.4	1590.4	1220	1220	1271.9	1732	

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
80-10-00-9601	24	1	LEFT ENGINE STARTER GENERATOR (REPLACE BEARINGS AND ARMATURE FUNCTIONAL CHECK) RESTORATION	LEFT ENGINE	9914685-1		P1323	SC	O	
Comment: Removed L/H starter-generator P/N: 9914685-1, S/N: P1664, due to time/restoration. Installed L/H starter-generator, overhauled by AMETEK B&S Aircraft Parts & Accessories of Wichita, KS., CRS# NE2R028L, in accordance with Cessna 680 MM 80-10-00. Leak and Ops check good.										
49-00-00-2100	25	2	APU GENERAL VISUAL INSPECTION							
Comment: Complied with Task 680 49-00-00-2100 APU General Visual Inspection.										
24-31-00-7201	26	2	LEFT SAFT NI-CAD BATTERY (CAPACITY CHECK) FUNCTIONAL CHECK	LEFT	023167-000		002610EE			
Comment: Complied with Task 24-31-00-7200 Left Marathon Ni-Cad Battery Functional check IAW Cessna 680 Maintenance Manual Chap. 24-31-00 and Battery Manufacturer's Instructions.										
24-31-00-7201	27	2	RIGHT SAFT NI-CAD BATTERY (CAPACITY CHECK) FUNCTIONAL CHECK	RIGHT	023167-000		002610ED			
Comment: Complied with Task 24-31-00-7200 Left Marathon Ni-Cad Battery Functional check IAW Cessna 680 Maintenance Manual Chap. 24-31-00 and Battery Manufacturer's Instructions.										
32-41-00-2800	28	2	LEFT NOSE LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	LEFT	3-1538-1		1700/1700		O	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Wheel was Overhauled by Falcon Crest Aviation, CRS# GP2R854K. Reference WO# 92558.										
32-41-00-2800	29	2	RIGHT NOSE LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	RIGHT	3-1538-1		1763/1763		O	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Wheel was Overhauled by Falcon Crest Aviation, CRS# GP2R854K. Reference WO# 92557.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected

Repair Facility Textron Aviation Service - MCO

Work Performed By Textron Aviation Service - MCO

Certified Repair Station Number 133C

Work Order # 156190

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

Certificate # CNQ8918C

Date 12-Aug-21

✓ Federal Aviation Administration

Other (specify) _____

THE AIRCRAFT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY AND APPROVED FOR RETURN TO SERVICE

Work Inspected By Bill Wright

Certificate # CNQ8918C

Date 12-Aug-21

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log

Section	Page
3	5

✓ Airframe Entries

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	12-Aug-21	KMCO	1590.4	1273	1590.4	1590.4	1220	1220	1271.9	1732	

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
324005	30	1	NOSE WHEEL TIRE	LEFT	M15601		1040T150	WO	N	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Reference entry above.										
324005	31	1	NOSE WHEEL TIRE	RIGHT	M15601		1039T185	WO	N	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Reference entry above.										
32	-		Horizontal Rear Spar CIC Application	Left						
Comment: Cleaned and applied CIC on LH horizontal stabilizer aft spar I.A.W Citation Standard Practices Manual Chapter 51-30-10.										
33	-		Horizontal Rear Spar CIC Application	RIGHT						
Comment: Cleaned and applied CIC to RH horizontal stabilizer aft spar I.A.W Citation Standard Practices Manual Chapter 51-30-10.										
34	-		MLG W/W keel beam (center spar) requires CIC.	RIGHT						
Comment: Cleaned and applied corrosion inhibitor compound (CIC) to R/H MLG wheel well center spar and surrounding area IAW Citation Standard Practices Manual 51-30-10.										
35	-		MLG W/W keel beam (center spar) requires CIC touch up.	LEFT						
Comment: Cleaned and applied corrosion inhibitor compound (CIC) to L/H MLG wheel well center spar and surrounding area IAW Citation Standard Practices Manual 51-30-10.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility Textron Aviation Service - MCO Certified Repair Station Number CNQ8918C Work Order # 156190

Work Performed By Textron Aviation Service - MCO Certificate No. CNQ8918C Date 12-Aug-21

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

✓ Federal Aviation Administration Other (specify) _____

THE AIRCRAFT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY AND APPROVED FOR RETURN TO SERVICE

Work Inspected By Bill Wright Certificate No. CNQ8918C Date 12-Aug-21

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log	
Section	Page
3	6



Aviation from the ground up

TEXTRON AVIATION

Maintenance Transaction Record

This Maintenance Report is To Be Used Solely For (Check One)

☒ Airframe
Entries

☐ Eng.#1
Serial No.

☐ Eng.#2
Serial No.

☐ APU
Serial No.

CAMP Systems International
8200 E. 34TH STREET
BUILDING 1600, SUITE 1607
Wichita, KS 67226
Phone: 316-462-2267/ Fax: 316-462-0791

2791484
Page 4 of 4

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Engine 1 Ttl Hrs	Engine 2 Ttl Hrs	Engine 1 Ttl Cycles	Engine 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	0237	N101CF	06-Dec-2017	KIWA	1057.3	842	1057.3	1057.3	805	805	721.6	1114	0

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Item	Transaction No.	Type	Item Name	Position	Part Number / Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR	Material Costs	Man Hours
345009	21	1	NO. 1 LOWER TRANSPONDER ANTENNA	NO. 1 LOWER	DMNI50-2-2		141457	UN	N	0 MTH 0 HRS		
Comments: Removed No. 1 Lower Transponder Antenna p/n: DMNI50-2-2 s/n: 116373 and installed new antenna p/n: DMNI50-2-2 s/n: 141457 IAW Cessna 680 MM 34-52-00. Ops checks good												
324005	22	1	LEFT NOSE WHEEL TIRE	LEFT	M15601		6147S208	UN	N	0 MTH 0 HRS		
Comments: Removed Left Nose Wheel Tire p/n: M15601 s/n: 2006C233 and installed new tire p/n: M15601 s/n: 6147S208 IAW Goodrich 3-1538-1 CMM 32-47-43												
320014	23	1	LEFT NOSE WHEEL	LEFT	3-1538-1		1700/1700	UN	O	0 MTH 0 HRS		
Comments: Removed Left Nose wheel p/n: 3-1538-1 s/n: 1700/1700 and sent out for overhauled. Reinstalled overhauled Left Nose wheel p/n: 3-1538-1 s/n: 1700/1700 IAW Cessna 680 MM 32-41-10. Overhauled by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022												
A324003	24	2	NON DESTRUCTIVE TEST LEFT NOSE WHEEL : INSPECTION DOCUMENT 31	LEFT	3-1538-1		1700/1700					
Comments: Full NDT Complied with by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022. Dated 10NOV2017. P/N: 3-1538-1 S/N: 1700/1700												
324005	25	1	RIGHT NOSE WHEEL TIRE	RIGHT	M15601		6146S192	UN	N	0 MTH 0 HRS		
Comments: Removed Right Nose Tire p/n: M15601 s/n: 2006C232 and installed new Right Nose wheel tire p/n: M15601 s/n: 6146S192 IAW Goodrich 3-1538-1 CMM 32-47-43												
320014	26	1	RIGHT NOSE WHEEL	RIGHT	3-1538-1		1763/1763	UN	O	0 MTH 0 HRS		
Comments: Removed Right Nose wheel p/n: 3-1538-1 s/n: 1763/1763 and sent out for overhauled. Reinstalled overhauled Right Nose wheel p/n: 3-1538-1 s/n: 1763/1763 IAW Cessna 680 MM 32-41-10. Overhauled by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022.												
A324003	27	2	NON DESTRUCTIVE TEST RIGHT NOSE WHEEL : INSPECTION DOCUMENT 31	RIGHT	3-1538-1		1763/1763					
Comments: Full NDT complied with by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022. Dated 10NOV2017. P/N: 3-1538-1 S/N: 1763/1763												
49APU1	28	1	APU		3800785-1		P423	UN	R			
Comments: Removed APU part no: 3800785-1 Removed serial no: P423. Installed APU, with TSN: 721.5 and CSN 1113 repaired by Honeywell International Inc., CRS# ZN3R030M, work order no. 2638231 on 5DEC2017 per the 680 MM CH 49-10-00. Leak and operational checks good.												

Trans Type: 1 - Component, 2 - Inspection, 3 - SB, 4 - AD, -- Misc.

Removal Reasons: WO - Worn to Limits, SC - Scheduled, UN - Unscheduled, CO - Convenience, N - Other (note in comments)

Installed Part Status: N - New, R - Repaired / Rebuilt, S - Serviceable, O - Overhauled, T - Tested, M - Modified, I - Inspected

Repair Facility	TEXTRON AVIATION SERVICE MESA	Certified Repair Station Number	CNQD918D	Work Order No.	67859
Work Performed By	TEXTRON AVIATION SERVICE MESA	Certificate No.	CRS# CNQD918C	Date	06-Dec-2017
I certify that the above stated maintenance and/or inspection was performed in accordance with the current regulations of the ☒ Federal Aviation Administration ☐ Other (Specify) _____ and _____ THE AIRCRAFT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY WITH REGARD TO THE WORK PERFORMED AND IS APPROVED FOR RETURN TO SERVICE. Work Inspected By TIMOTHY J. ESKER <i>Timothy J. Esker</i> Certificate No. _____ CRS# CNQD918C Date 06-Dec-2017 Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3	4


☒ Airframe
Entire

☐ Eng. #1
Serial No.

☐ Eng. #2
Serial No.

☐ APU
Serial No.

CAMP Maintenance Transaction Record This Maintenance Report is To Be Used Solely For (Check One)

 MTR ID # 2179933
 Page 1 of 4

 CAMP Systems International
 6200 E. 34TH STREET
 BUILDING 1600, SUITE 1607
 Wichita, KS 67226
 Phone: 316-462-2267 / Fax: 316-462-0791

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Engine 1 Total Hrs	Engine 2 Total Hrs	Engine 1 Ttl Cycles	Engine 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	0237	PR-EGS	19-Sep-2013	MCO	537.8	452	537.8	537.8	419	419	337	530.00	

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Item	Transaction No. Type	Item Name	Position	Part Number / Alternate Part	Mod Level	Part Serial	Removal Reason	Installed Part Status TSN/TSO/TSR	Material Costs	Man Hours
275012	1 1	HORIZONTAL TRIM ACTUATOR CONTROL UNIT		103000A	9914197-9	270	UN	O 0 MTH 0 HRS		
Comments: Removed part no: 103000 Removed serial no: 376. Unit overhauled by GAR Enterprises Inc., Arcadia, CA., CRS# K3GR925J, and installed IAW 680 M.M. ch. 27-40-00. Operational check good.										
324005 324005 : L	2 1	LEFT NOSE WHEEL TIRE	LEFT	M15601	9914718-1	2006C233	WO	N 0 MTH 0 HRS		
Comments: Removed part no: M15601 Removed serial no: 7345A148. Installed new tire on wheel assembly SN: 1763 as first tire change - no NDT required. Done IAW B.F. Goodrich C.M.M. 32-47-43. leak and balance checks good.										
324005 324005 : R	3 1	RIGHT NOSE WHEEL TIRE	RIGHT	M15601	9914718-1	2006C232	WO	N 0 MTH 0 HRS		
Comments: Removed part no: M15601 Removed serial no: 7338A096. Installed new tire on wheel assembly SN: 1700 as first tire change - no NDT required. Done IAW B.F. Goodrich C.M.M. 32-47-43. leak and balance checks good.										
262004	4 1	NOSE COMPARTMENT BAGGAGE (UN002) FIRE BOTTLE	NOSE COMPARTMENT	34750005-1	9914712-6	10439H1	SC	O 0 MTH 0 HRS		
Comments: Removed part no: 34750005-1 Removed serial no: 10439H1. Unit overhauled by Pacific Scientific, Miami, FL, CRS# P94R580N, and installed IAW 680 M.M. ch. 26-20-30. MFR date 08/2008. Next hydro date due 07/2018.										
262003 262003 : HIGH	5 1	UPPER NOSE COMPARTMENT FIRE BOTTLE (MAX LIFE) FIRE EXT SQUIB	UPPER	30903871		1525PD	SC	N 3 MTH		
Manufacture Date: 01-Jul-2013 Comments: Removed part no: 30903838 Removed serial no: 0030JF. New unit installed with bottle SN: 10439H1. MFG date July 2013.										
262003 262003 : LOW	6 1	LOWER NOSE COMPARTMENT FIRE BOTTLE (MAX LIFE) FIRE EXT SQUIB	LOWER	30903872		1334PE	SC	N 3 MTH		
Manufacture Date: 01-Jul-2013 Comments: Removed part no: 30903937 Removed serial no: 1133JE. New unit installed with bottle SN: 10439H1. MFG date July 2013.										

Trans. Type: 1 - Component, 2 - Inspection, 3 - GS, 4 - AD, -- Misc.


Removal Reasons: WO - Worn to Limits, SC - Scheduled, UN - Unscheduled, CO - Convenience, N - Other (note in comments)

Installed Part Status: N - New, R - Repaired/Rebuilt, S - Serviceable, O - Overhauled

Repair Facility	ORLANDO CITATION SERVICE CENTER	Certified Repair Station Number	1106-41/ANAC	Work Order No.	6043883
Work Performed By	ORLANDO CITATION SERVICE CENTER				
	Certificate No.	1106-41/ANAC	Date	19-Sep-2013	
I certify that the above stated maintenance and/or inspection was performed in accordance with the current regulations of the ☐ Federal Aviation Administration ☒ Other (Specify) BRAZIL ANAC and					
I CERTIFY THAT THE ABOVE MAINTENANCE & INFORMATION CONTAINED IN THE LISTED WORK ORDER WAS PERFORMED IN ACCORDANCE WITH THE CURRENT BRAZIL REPAIR STATION OPERATIONS SPECIFICATIONS CERTIFICATE NUMBER 1106-41/ANAC & THE AIRCRAFT/COMPONENT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY AND APPROVED FOR RETURN TO SERVICE.					
Work Inspected By	GARY DUCHARME	Certificate No.	1106-41/ANAC	Date	19-Sep-2013
Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3PT4	

Wheel History

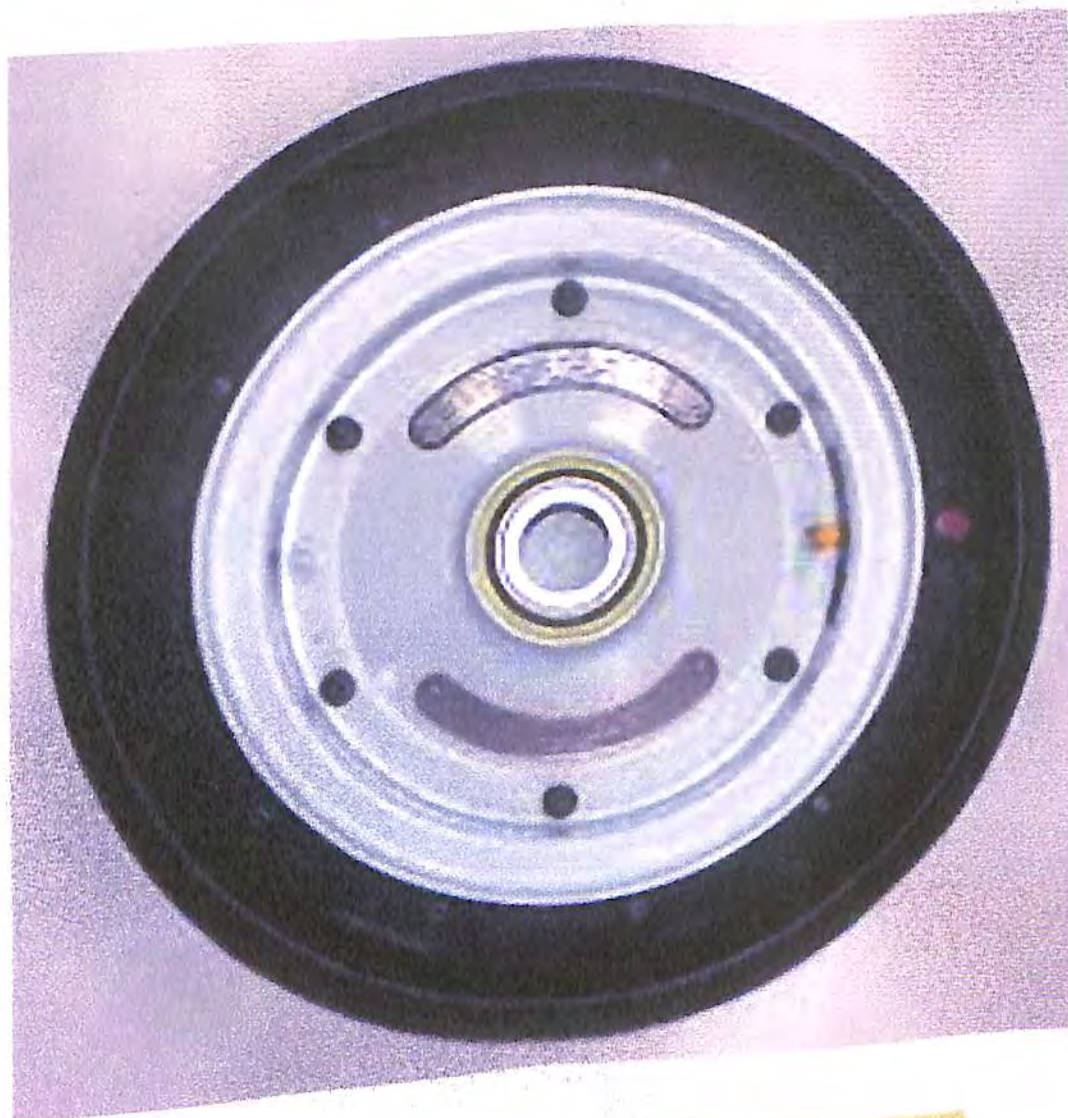

P/N 3-1538-1

S/N 1763



TEXTRON AVIATION

Maintenance Transaction Record

This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8181967

Page 1 of 1

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	12-Jun-23	KBED	1972.0	1516							

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
	1	1		RH Nose	M15601		1345T179	WO	N	
Comment: Installed new RH Nose wheel/tire IAW BF Goodrich CMM. 3-1538 REV.3 CH 32-47-43. Installed RH tire wheel assy IAW Model 680 MM CH. 32-41-10. P/N OFF: M15601 S/N OFF: 1039T185.										
	2	1		LH Nose	M15601		2307T159	WO	N	
Comment: Installed new LH nose wheel/tire IAW BF Goodrich CMM 3-1538 REV. 3 CH. 32-47-43. Installed LH nose wheel/tire assy IAW Model 680 MM CH. 32-41-10. P/N OFF: M15601 S/N OFF: 1040T150										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other(note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility <u>NYCSC</u>	Certified Repair Station Number <u>CNQ6918C</u>	Work Order # <u>193961</u>
Work Performed By <u>Dan Whitehead</u>	Certificate No. <u>CNQ6918C</u>	Date <u>12-Jun-23</u>
I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the ✓ Federal Aviation Administration Other (specify) _____ and the aircraft/component identified above is presently airworthy & approved for return to service.		
Work Inspected By <u>Dan Whitehead</u>	Certificate No. <u>CNQ6918C</u>	Date <u>12-Jun-23</u>
ELECTRONICALLY SIGNED ON 12-JUN-23 Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.		

Maintenance Log	
Section	Page
3	



TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

MTR ID # 8100654 Replaces MTR ID # 8098043

Page 5 of 6

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Airframe Entries

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	12-Aug-21	KMCO	1590.4	1273	1590.4	1590.4	1220	1220	1271.9	1732	

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
80-10-00-9601	24	1	LEFT ENGINE STARTER GENERATOR (REPLACE BEARINGS AND ARMATURE FUNCTIONAL CHECK) RESTORATION	LEFT ENGINE	9914685-1		P1323	SC	O	
Comment: Removed L/H starter-generator P/N: 9914685-1, S/N: P1664, due to time/restoration. Installed L/H starter-generator, overhauled by AMETEK B&S Aircraft Parts & Accessories of Wichita, KS., CRS# NE2R028L, in accordance with Cessna 680 MM 80-10-00. Leak and Ops check good.										
49-00-00-2100	25	2	APU GENERAL VISUAL INSPECTION							
Comment: Complied with Task 680 49-00-00-2100 APU General Visual Inspection.										
24-31-00-7201	26	2	LEFT SAFT NI-CAD BATTERY (CAPACITY CHECK) FUNCTIONAL CHECK	LEFT	023167-000		002610EE			
Comment: Complied with Task 24-31-00-7200 Left Marathon Ni-Cad Battery Functional check IAW Cessna 680 Maintenance Manual Chap. 24-31-00 and Battery Manufacturer's Instructions.										
24-31-00-7201	27	2	RIGHT SAFT NI-CAD BATTERY (CAPACITY CHECK) FUNCTIONAL CHECK	RIGHT	023167-000		002610ED			
Comment: Complied with Task 24-31-00-7200 Left Marathon Ni-Cad Battery Functional check IAW Cessna 680 Maintenance Manual Chap. 24-31-00 and Battery Manufacturer's Instructions.										
32-41-00-2800	28	2	LEFT NOSE LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	LEFT	3-1538-1		1700/1700		O	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Wheel was Overhauled by Falcon Crest Aviation, CRS# GP2R854K. Reference WO# 92556.										
32-41-00-2800	29	2	RIGHT NOSE LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	RIGHT	3-1538-1		1763/1763		O	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Wheel was Overhauled by Falcon Crest Aviation, CRS# GP2R854K. Reference WO# 92557.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc. Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected

Repair Facility Textron Aviation Service - MCO

Work Performed By Textron Aviation Service - MCO

Certified Repair Station Number C-13C

Work Order # 156190

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

Certificate # CNQ8918C

Date 12-Aug-21

☒ Federal Aviation Administration Other (specify) _____

THE AIRCRAFT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY AND APPROVED FOR RETURN TO SERVICE

Work Inspected By Bill Wright

Certificate # CNQ8918C

Date 12-Aug-21

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log

Section	Page
3	5

☒ Airframe Entries

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	12-Aug-21	KMCO	1590.4	1273	1590.4	1590.4	1220	1220	1271.9	1732	

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No. Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
324005	30 1	NOSE WHEEL TIRE	LEFT	M15601		1040T150	WO	N	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Reference entry above.									
324005	31 1	NOSE WHEEL TIRE	RIGHT	M15601		1039T185	WO	N	
Comment: Installed customer supplied Wheel/Tire Assembly IAW Goodrich CMM Chap. 32-47-23. Reference entry above.									
32	-	Horizontal Rear Spar CIC Application	Left						
Comment: Cleaned and applied CIC on LH horizontal stabilizer aft spar I.A.W Citation Standard Practices Manual Chapter 51-30-10.									
33	-	Horizontal Rear Spar CIC Application	RIGHT						
Comment: Cleaned and applied CIC to RH horizontal stabilizer aft spar I.A.W Citation Standard Practices Manual Chapter 51-30-10.									
34	-	MLG W/W keel beam (center spar) requires CIC.	RIGHT						
Comment: Cleaned and applied corrosion inhibitor compound (CIC) to R/H MLG wheel well center spar and surrounding area IAW Citation Standard Practices Manual 51-30-10.									
35	-	MLG W/W keel beam (center spar) requires CIC touch up.	LEFT						
Comment: Cleaned and applied corrosion inhibitor compound (CIC) to L/H MLG wheel well center spar and surrounding area IAW Citation Standard Practices Manual 51-30-10.									

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility Textron Aviation Service - MCO

Work Performed By Textron Aviation Service - MCO

Certified Repair Station Number CNQ8918C

Certificate No. CNQ8918C


Work Order # 156190

Date 12-Aug-21

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

☒ Federal Aviation Administration Other (specify) _____

THE AIRCRAFT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY AND APPROVED FOR RETURN TO SERVICE

Work Inspected By Bill Wright 

Certificate No. CNQ8918C

Date 12-Aug-21

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log	
Section	Page
3	6



Aviation from the ground up

TEXTRON AVIATION

Maintenance Transaction Record

This Maintenance Report is To Be Used Solely For (Check One)

☒ Airframe Entries

☐ Eng.#1 Serial No.

☐ Eng.#2 Serial No.

☐ APU Serial No.

CAMP Systems International
8200 E. 34TH STREET
BUILDING 1600, SUITE 1607
Wichita, KS 67226
Phone: 316-462-2267/ Fax: 316-462-0791

J # 2791484

Page 4 of 4

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Engine 1 Ttl Hrs	Engine 2 Ttl Hrs	Engine 1 Ttl Cycles	Engine 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	0237	N101CF	06-Dec-2017	KIWA	1057.3	842	1057.3	1057.3	805	805	721.6	1114	0

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Item	Transaction No.	Type	Item Name	Position	Part Number / Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR	Material Costs	Man Hours
345009	21	1	NO. 1 LOWER TRANSPONDER ANTENNA	NO. 1 LOWER	DMNI50-2-2		141457	UN	N	0 MTH 0 HRS		
Comments: Removed No. 1 Lower Transponder Antenna p/n: DMNI50-2-2 s/n: 116373 and installed new antenna p/n: DMNI50-2-2 s/n: 141457 IAW Cessna 680 MM 34-52-00. Ops checks good												
324005	22	1	LEFT NOSE WHEEL TIRE	LEFT	M15601		6147S208	UN	N	0 MTH 0 HRS		
Comments: Removed Left Nose Wheel Tire p/n: M15601 s/n: 2006C233 and installed new tire p/n: M15601 s/n: 6147S208 IAW Goodrich 3-1538-1 CMM 32-47-43												
320014	23	1	LEFT NOSE WHEEL	LEFT	3-1538-1		1700/1700	UN	O	0 MTH 0 HRS		
Comments: Removed Left Nose wheel p/n: 3-1538-1 s/n: 1700/1700 and sent out for overhauled. Reinstalled overhauled Left Nose wheel p/n: 3-1538-1 s/n: 1700/1700 IAW Cessna 680 MM 32-41-10. Overhauled by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022												
A324003	24	2	NON DESTRUCTIVE TEST LEFT NOSE WHEEL : INSPECTION DOCUMENT 31	LEFT	3-1538-1		1700/1700					
Comments: Full NDT Complied with by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022. Dated 10NOV2017. P/N: 3-1538-1 S/N: 1700/1700												
324005	25	1	RIGHT NOSE WHEEL TIRE	RIGHT	M15601		6146S192	UN	N	0 MTH 0 HRS		
Comments: Removed Right Nose Tire p/n: M15601 s/n: 2006C232 and installed new Right Nose wheel tire p/n: M15601 s/n: 6146S192 IAW Goodrich 3-1538-1 CMM 32-47-43												
320014	26	1	RIGHT NOSE WHEEL	RIGHT	3-1538-1		1763/1763	UN	O	0 MTH 0 HRS		
Comments: Removed Right Nose wheel p/n: 3-1538-1 s/n: 1763/1763 and sent out for overhauled. Reinstalled overhauled Right Nose wheel p/n: 3-1538-1 s/n: 1763/1763 IAW Cessna 680 MM 32-41-10. Overhauled by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022.												
A324003	27	2	NON DESTRUCTIVE TEST RIGHT NOSE WHEEL : INSPECTION DOCUMENT 31	RIGHT	3-1538-1		1763/1763					
Comments: Full NDT complied with by Accessory Overhaul Group, LLC FAA# 7OVR008C Work Order# 2636022. Dated 10NOV2017. P/N: 3-1538-1 S/N: 1763/1763												
49APU1	28	1	APU		3800785-1		P423	UN	R			
Comments: Removed APU part no: 3800785-1 Removed serial no: P423. Installed APU, with TSN: 721.5 and CSN 1113 repaired by Honeywell International Inc., CRS# ZN3R030M, work order no. 2638231 on 5DEC2017 per the 680 MM CH 49-10-00. Leak and operational checks good.												

Trans Type: 1 - Component, 2 - Inspection, 3 - SB, 4 - AD, -- Misc.

Removal Reasons: WO - Worn to Limits, SC - Scheduled, UN - Unscheduled, CO - Convenience, N - Other (note in comments)

Installed Part Status: N - New, R - Repaired / Rebuilt, S - Serviceable, O - Overhauled, T - Tested, M - Modified, I - Inspected

Repair Facility	TEXTRON AVIATION SERVICE MESA	Certified Repair Station Number	CNQD918D	Work Order No.	67859
Work Performed By	TEXTRON AVIATION SERVICE MESA	Certificate No.	CRS# CNQD918C	Date	06-Dec-2017
I certify that the above stated maintenance and/or inspection was performed in accordance with the current regulations of the ☒ Federal Aviation Administration ☐ Other (Specify) _____ and THE AIRCRAFT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY WITH REGARD TO THE WORK PERFORMED AND IS APPROVED FOR RETURN TO SERVICE.					
Work Inspected By	TIMOTHY J. ESKER <i>Timothy J. Esker</i>	Certificate No.	CRS# CNQD918C	Date	06-Dec-2017
Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3	4



☒ Airframe
Entries

☐ Eng. #1
Serial No.

☐ Eng. #2
Serial No.

☐ APU
Serial No.

CAMP
Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For (Check One)

MTR ID # 2178923
Page 1 of 4

CAMP Systems International
6200 E. 34TH STREET
BUILDING 1600, SUITE 1607
Wichita, KS 67226
Phone: 316-462-2287 / Fax: 316-462-0791

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Engine 1 Total Hrs	Engine 2 Total Hrs	Engine 1 Td Cycles	Engine 2 Td Cycles	APU Hrs	APU Events	Freon Hrs
660-0237	0237	PR-EGS	19-Sep-2013	MCO	537.8	452	537.8	537.8	419	419	337	530.00	

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Item	Transaction No. Type	Item Name	Position	Part Number / Alternate Part	Mod Level	Part Serial	Removal Reason	Installed Part Status	TSN/TSO/TSR	Material Costs	Man Hours
275012	1 1	HORIZONTAL TRIM ACTUATOR CONTROL UNIT		103000A	9914187-9	270	UN	O	0 MTH 0 HRS		
Comments: Removed part no: 103000 Removed serial no: 376. Unit overhauled by GAR Enterprises Inc., Arcadia, CA, CRS# K3GR925J, and installed IAW 680 M.M. ch. 27-40-00. Operational check good.											
324005 324005 : L	2 1	LEFT NOSE WHEEL TIRE	LEFT	M15601	9914718-1	2006C233	WVO	N	0 MTH 0 HRS		
Comments: Removed part no: M15601 Removed serial no: 7345A146. Installed new tire on wheel assembly SN: 1763 as first tire change - no NDT required. Done IAW B.F. Goodrich C.M.M. 32-47-43. leak and balance checks good.											
324005 324005 : R	3 1	RIGHT NOSE WHEEL TIRE	RIGHT	M15601	9914718-1	2006C232	WO	N	0 MTH 0 HRS		
Comments: Removed part no: M15601 Removed serial no: 7338A086. Installed new tire on wheel assembly SN: 1700 as first tire change - no NDT required. Done IAW B.F. Goodrich C.M.M. 32-47-43. leak and balance checks good.											
262004	4 1	NOSE COMPARTMENT BAGGAGE (UN002) FIRE BOTTLE	NOSE COMPARTMENT	34750005-1	9914712-6	10439H1	SC	O	0 MTH 0 HRS		
Comments: Removed part no: 34750005-1 Removed serial no: 10439H1. Unit overhauled by Pacific Scientific, Miami, FL, CRS# P84R580N, and installed IAW 680 M.M. ch. 26-20-30. MFR date 08/2008. Next hydro date due 07/2018.											
262003 262003 : HIGH	5 1	UPPER NOSE COMPARTMENT FIRE BOTTLE (MAX LIFE) FIRE EXT SQUIB	UPPER	30903871		1525PD	SC	N	3 MTH		
Manufacture Date: 01-Jul-2013 Comments: Removed part no: 30903838 Removed serial no: 0030JF. New unit installed with bottle SN: 10439H1. MFG date July 2013.											
262003 262003 : LOW	6 1	LOWER NOSE COMPARTMENT FIRE BOTTLE (MAX LIFE) FIRE EXT SQUIB	LOWER	30903872		1334PE	SC	N	3 MTH		
Manufacture Date: 01-Jul-2013 Comments: Removed part no: 30903937 Removed serial no: 1133JE. New unit installed with bottle SN: 10439H1. MFG date July 2013.											

Trans. Type: 1 - Component, 2 - Inspection, 3 - SB, 4 - AD, -- Misc.

Removal Reasons: WO - Worn to Limits, SC - Scheduled, UN - Unscheduled, CO - Convenience, N - Other (note in comments)

Installed Part Status: N - New, R - Repaired/Rebuilt, S - Serviceable, O - Overhauled

Repair Facility	ORLANDO CITATION SERVICE CENTER	Certified Repair Station Number	1106-41/ANAC	Work Order No.	6043663
Work Performed By	ORLANDO CITATION SERVICE CENTER	Certificate No.	1106-41/ANAC	Date	19-Sep-2013
I certify that the above stated maintenance and/or inspection was performed in accordance with the current regulations of the					
☐ Federal Aviation Administration ☒ Other (Specify) BRAZIL ANAC and					
I CERTIFY THAT THE ABOVE MAINTENANCE & INFORMATION CONTAINED IN THE LISTED WORK ORDER WAS PERFORMED IN ACCORDANCE WITH THE CURRENT BRAZIL REPAIR STATION OPERATIONS SPECIFICATIONS CERTIFICATE NUMBER 1106-41/ANAC & THE AIRCRAFT/COMPONENT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY AND APPROVED FOR RETURN TO SERVICE.					
Work Inspected By	GARY DUCHARME	Certificate No.	1106-41/ANAC	Date	19-Sep-2013
Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3PT4	

Wheel History



P/N 3-1621

S/N 3256

This set of wheels and tires was moved from spare status and installed on aircraft in July/2023. When these wheels were reinstalled on the aircraft on 8-2-2023 (MTR Date) they had 1 tire change, 1 ~~overhaul~~ and 186 landings.

Wheel 3256 / Tire 1214K111

Wheel 3261 / Tire 1214K102

Wheel 3262 / Tire 1211K101

Wheel 3831 / Tire 1212K109



TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8189066 Replaces MTR ID # 8188154

Page 7 of 11

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	02-Aug-23	KSAT	2003.9	1530	2003.9	2003.9	1530	1530			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
32-41-00-2200	35	2	LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	LEFT OUTBOARD	3-1621		2239			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
32-41-00-2200	36	2	LEFT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	LEFT INBOARD	3-1621		2237			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 LEFT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
32-41-00-2200	37	2	RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT INBOARD	3-1621		2238			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
32-41-00-2200	38	2	RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT OUTBOARD	3-1621		2241			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
324009	39	1	MAIN LANDING GEAR WHEEL	LEFT INBOARD	3-1621		3256	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H INBOARD WHEEL IRT GOODRICH M/M 32-45-53. INSTALLED CUSTOMER SUPPLIED LEFT INBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3256 WITH TIRE PN: M14401 SN: 1214K111 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324009	40	1	MAIN LANDING GEAR WHEEL	LEFT OUTBOARD	3-1621		3261	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H OUTBOARD WHEEL IRT GOODRICH M/M. 32-45-53 INSTALLED CUSTOMER SUPPLIED LEFT OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3261 WITH TIRE PN: M14401 SN: 1214K102 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility	Textron Aviation Service - SAT	Certified Repair Station Number	CNQ5918C	Work Order #	191294
Work Performed By	Textron Aviation Service - SAT	Certificate No.	CNQ5918C	Date	02-Aug-23
I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the					
☒ Federal Aviation Administration Other (specify) _____					
I CERTIFY THAT THE ABOVE MAINTENANCE & INFORMATION CONTAINED IN THE LISTED WORK ORDER WAS PERFORMED IN ACCORDANCE WITH THE CURRENT FAA REGULATIONS & THE AIRCRAFT/COMPONENT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY & APPROVED FOR RETURN TO SERVICE					
<i>Eric Cortinas</i>					
Work Inspected By	Eric Cortinas	Certificate No.	CNQ5918C	Date	02-Aug-23
ELECTRONICALLY SIGNED ON 02-AUG-23					
Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3	7

This set of wheels and tires was due a tire change. As a precaution against corrosion the wheels were overhauled by TEXTRON/Orlando with new tires and were then put into spare status. ^{NOT}

Removed	Installed
Wheel 3256 / Tire 8317J105	1214K111
Wheel 3261 / Tire 8317J112	1214K102
Wheel 3262 / Tire 9059J118	1211K101
Wheel 3831 / Tire 9062J125	1212K109

This set of wheels and tires was purchased in December of 2019 to replace our other set of main wheels that were condemned for corrosion when we went into maintenance for a tire change.

Wheel 3256 / Tire 8317J105

Wheel 3261 / Tire 8317J112

Wheel 3262 / Tire 9059J118

Wheel 3831 / Tire 9062J125

Beechcraft



Textron

TEXTRON AVIATION

TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8020153

Page 2 of 3

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

V/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	13-Dec-19	KMCO	1366.3	1106	1106.0	1106.0	1052	1052			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
32-41-00-2200	8	2	LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	LEFT OUTBOARD						
Comment: Complied with LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW task 32-41-00-2200										
32-41-00-2200	9	2	RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT INBOARD						
Comment: Complied with RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW task 32-41-00-2200										
32-41-00-2200	10	2	RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT OUTBOARD						
Comment: Complied with RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW task 32-41-00-2200										
32-41-00-2801	11	2	RIGHT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	RIGHT OUTBOARD	6941060-1		3256			
Comment: Complied with RIGHT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.										
32-41-00-2801	12	2	LEFT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	LEFT INBOARD	6941060-1		3262			
Comment: Complied with LEFT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.										
32-41-00-2801	13	2	RIGHT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	RIGHT INBOARD	6941060-1		3831			
Comment: Complied with RIGHT INBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected

Repair Facility Textron Aviation Service - MCOCertified Repair Station Number CNQ8918CWork Order # 122691Work Performed By Textron Aviation Service - MCOCertificate No. CNQ8918CDate 13-Dec-19

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

✓ Federal Aviation Administration

Other (specify) _____

ALL MAINTENANCE WAS PERFORMED IN ACCORDANCE WITH APPROVED/CURRENT TECHNICAL DATA.

Work Inspected By Hans FurberCertificate No. CNQ8918CDate 13-Dec-19

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log

Section	Page
3	2

Beechcraft



Zawler

TEXTRON AVIATION

TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8020153

Page 3 of 3

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	13-Dec-19	KMCO	1366.3	1106	1106.0	1106.0	1052	1052			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
324009	14	1	MAIN LANDING GEAR TIRE	LEFT OUTBOARD	M14401		8317J112	WO	N	
Comment: Removed PN: M14401 SN: 7231J123 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
324009	15	1	MAIN LANDING GEAR TIRE	LEFT INBOARD	M14401		9059J118	WO	N	
Comment: Removed PN: M14401 SN: 7232J115 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
324009	16	1	MAIN LANDING GEAR TIRE	RIGHT INBOARD	M14401		9062J125	WO	N	
Comment: Removed PN: M14401 SN: 7239J118 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
324009	17	1	MAIN LANDING GEAR TIRE	RIGHT OUTBOARD	M14401		8317J105	WO	N	
Comment: Removed PN: M14401 SN: 7232J116 due tire wear. Installed new tire leak checked good IAW Goodrich CMM 32-45-53										
32-41-00-2801	18	2	LEFT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT)	LEFT OUTBOARD	6941060-1		3261			
Comment: Complied with LEFT OUTBOARD MAIN LANDING GEAR WHEEL ASSEMBLY SPECIAL DETAILED INSPECTION (NDT) DYE PENETRANT INSPECTION by installing new wheel assembly.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility Textron Aviation Service - MCOCertified Repair Station Number CNQ8918CWork Order # 122691Work Performed By Textron Aviation Service - MCOCertificate No. CNQ8918CDate 13-Dec-19

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

✓ Federal Aviation Administration

Other (specify) _____

ALL MAINTENANCE WAS PERFORMED IN ACCORDANCE WITH APPROVED/CURRENT TECHNICAL DATA.

Work Inspected By Hans Furber

64309
HEF
Certificate No. CNQ8918CDate 13-Dec-19

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log

Section	Page
3	3

Wheel History



P/N 3-1621

S/N 3261

This set of wheels and tires was moved from spare status and installed on aircraft in July/2023. When these wheels were reinstalled on the aircraft on 8-2-2023 (MTR Date) they had 1 tire change, 1-overhaul and 186 landings.

Wheel 3256 / Tire 1214K111

Wheel 3261 / Tire 1214K102

Wheel 3262 / Tire 1211K101

Wheel 3831 / Tire 1212K109



TEXTRON AVIATION

Maintenance Transaction Record

This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8189066 Replaces MTR ID # 8188154

Page 7 of 11

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 TII Hrs	Eng. 2 TII Hrs	Eng. 1 TII Cycles	Eng. 2 TII Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	02-Aug-23	KSAT	2003.9	1530	2003.9	2003.9	1530	1530			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
32-41-00-2200	35	2	LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	LEFT OUTBOARD	3-1621		2239			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 LEFT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
32-41-00-2200	36	2	LEFT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	LEFT INBOARD	3-1621		2237			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 LEFT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
32-41-00-2200	37	2	RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT INBOARD	3-1621		2238			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 RIGHT INBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
32-41-00-2200	38	2	RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION	RIGHT OUTBOARD	3-1621		2241			
Comment: COMPLIED WITH TASK ITEM 32-41-00-2200 RIGHT OUTBOARD MAIN LANDING GEAR WHEEL AND TIRE DETAILED INSPECTION IAW 680 M/M CHAPTER 32-41-00.										
324009	39	1	MAIN LANDING GEAR WHEEL	LEFT INBOARD	3-1621		3256	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H INBOARD WHEEL IRT GOODRICH M/M 32-45-53. INSTALLED CUSTOMER SUPPLIED LEFT INBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3256 WITH TIRE PN: M14401 SN: 1214K111 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324009	40	1	MAIN LANDING GEAR WHEEL	LEFT OUTBOARD	3-1621		3261	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H OUTBOARD WHEEL IRT GOODRICH M/M 32-45-53 INSTALLED CUSTOMER SUPPLIED LEFT OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3261 WITH TIRE PN: M14401 SN: 1214K102 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other (note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhauled, T-Tested, M-Modified, I-Inspected.

Repair Facility Textron Aviation Service - SAT

Certified Repair Station Number CNQ5918C

Work Order # 191294

Work Performed By Textron Aviation Service - SAT

Certificate No. CNQ5918C

Date 02-Aug-23

I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the

✓ Federal Aviation Administration

Other (specify) _____

I CERTIFY THAT THE ABOVE MAINTENANCE & INFORMATION CONTAINED IN THE LISTED WORK ORDER WAS PERFORMED IN ACCORDANCE WITH THE CURRENT FAA REGULATIONS & THE AIRCRAFT/COMPONENT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY & APPROVED FOR RETURN TO SERVICE

Eric Cortinas

Work Inspected By Eric Cortinas

Certificate No. CNQ5918C

Date 02-Aug-23

ELECTRONICALLY SIGNED ON 02-AUG-23

Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.

Maintenance Log

Section	Page
3	7

This set of wheels and tires was due a tire change. As a precaution against corrosion the wheels were overhauled by TEXTRON/Orlando with new tires and were then put into spare status. ^{NOT}

Removed	Installed
Wheel 3256 / Tire 8317J105	1214K111
Wheel 3261 / Tire 8317J112	1214K102
Wheel 3262 / Tire 9059J118	1211K101
Wheel 3831 / Tire 9062J125	1212K109

Wheel History



P/N 3-1621

S/N 3262

This set of wheels and tires was moved from spare status and installed on aircraft in July/2023. When these wheels were reinstalled on the aircraft on 8-2-2023 (MTR Date) they had 1 tire change, ~~1 overhaul~~ and 186 landings.

Wheel 3256 / Tire 1214K111

Wheel 3261 / Tire 1214K102

Wheel 3262 / Tire 1211K101

Wheel 3831 / Tire 1212K109



TEXTRON AVIATION

Maintenance Transaction Record
This Maintenance Report is To Be Used Solely For:

✓ Airframe Entries

MTR ID # 8188154 Replaces MTR ID # 8188146

Page 8 of 11

Textron Aviation
One Cessna Blvd.
Wichita, KS 67215 U.S.A.
Phone: +1(316)517-6000

Aircraft Identification and Status

A/C Serial #	A/C Unit #	A/C Registration #	Date	City ID	Total A/C Hours	Total A/C Landings	Eng. 1 Ttl Hrs	Eng. 2 Ttl Hrs	Eng. 1 Ttl Cycles	Eng. 2 Ttl Cycles	APU Hrs	APU Events	Freon Hrs
680-0237	237	N680SA	02-Aug-23	KSAT	2003.9	1530	2003.9	2003.9	1530	1530			

Component Changes, Inspections, Service Bulletins, or Airworthiness Directives Accomplished

Task/Item	Transaction No.	Type	Item Name	Position	Part Number/Alternate Part	Mod Level	Part Serial	Removal Reason	Status	Installed Part TSN/TSO/TSR
324009	41	1	MAIN LANDING GEAR WHEEL	RIGHT OUTBOARD	3-1621		3262	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM R/H OUTBOARD MAIN WHEEL ITR GOODRICH 32-45-53 INSTALLED CUSTOMER SUPPLIED RH OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3262 WITH TIRE PN: M14401 SN: 1211K101 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324009	42	1	MAIN LANDING GEAR WHEEL	RIGHT INBOARD	2-1621		3831	UN	I	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM R/H INBOARD WHEEL ITR GOODRICH M/M32-45-53. INSTALLED CUSTOMER SUPPLIED RH INBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3831 WITH TIRE PN: M14401 SN: 1212K109 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324010	43	1	MAIN LANDING GEAR TIRE	LEFT INBOARD	M14401		1214K111	UN	N	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H INBOARD WHEEL ITR GOODRICH M/M 32-45-53. INSTALLED CUSTOMER SUPPLIED LEFT INBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3256 WITH TIRE PN: M14401 SN: 1214K111 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324210	44	1	MAIN LANDING GEAR TIRE	LEFT OUTBOARD	M14401		1214K102	UN	N	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM L/H OUTBOARD WHEEL ITR GOODRICH M/M. 32-45-53 INSTALLED CUSTOMER SUPPLIED LEFT OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3261 WITH TIRE PN: M14401 SN: 1214K102 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										
324010	45	1	MAIN LANDING GEAR TIRE	RIGHT OUTBOARD	M14401		1211K101	UN	N	
Comment: REMOVED WHEEL ASSEMBLY WITH TIRE FROM R/H OUTBOARD MAIN WHEEL ITR GOODRICH 32-45-53 INSTALLED CUSTOMER SUPPLIED RH OUTBOARD MAIN WHEEL ASSEMBLY PN: 3-1621 SN: 3262 WITH TIRE PN: M14401 SN: 1211K101 IAW 680 M/M CHAPTER 32-41-20. WHEEL ASSEMBLY INSPECTED BY TEXTRON AVIATION - ORLANDO CRS# CNQ8918C. REFERENCE WORK ORDER 161678 ON 8130 DATED OCTOBER 25, 2021.										

Trans Type: 1-Component, 2-Inspection, 3-SB, 4-AD, -Misc Removal Reasons: WO-Worn to Limits, SC-Scheduled, UN-Unscheduled, CO-Convenience, N-Other(note in comments)

Installed Part Status: N-New, R-Repaired/Rebuilt, S-Serviceable, O-Overhaul, T-Tested, M-Modified, I-Inspected.

Repair Facility	Textron Aviation Service - SAT	Certified Repair Station Number	CNQ5918C	Work Order #	191294
Work Performed By	Textron Aviation Service - SAT	Certificate No.	CNQ5918C	Date	02-Aug-23
I certify that the above maintenance & information contained in the listed work order was performed in accordance with the current regulations of the					
✓ Federal Aviation Administration		Other (specify) _____			
I CERTIFY THAT THE ABOVE MAINTENANCE & INFORMATION CONTAINED IN THE LISTED WORK ORDER WAS PERFORMED IN ACCORDANCE WITH THE CURRENT FAA REGULATIONS & THE AIRCRAFT/COMPONENT IDENTIFIED ABOVE IS PRESENTLY AIRWORTHY & APPROVED FOR RETURN TO SERVICE					
Work Inspected By		Eric Cortinas		Certificate No.	CNQ5918C
		ELECTRONICALLY SIGNED ON 02-AUG-23		Date	02-Aug-23
Pertinent details of this maintenance are on file at our facility under the above Work/Service Order Number as applicable.					

Maintenance Log	
Section	Page
3	8

of wheels and tires was due a tire change. As a precaution against corrosion the wheels were overhauled ^{NOT} RON/Orlando with new tires and were then put into spare status.

Removed	Installed
256 / Tire 8317J105	1214K111
261 / Tire 8317J112	1214K102
262 / Tire 9059J118	1211K101
831 / Tire 9062J125	1212K109